	Vehicle History Report [™]
1984 PORSCHE 911 CARRERA	No accidents or damage reported to CARFAX
VIN: WP0AB0911ES122095 COUPE 3.2L H6 F GASOLINE REAR WHEEL DRIVE	2 Service history records
	16 Detailed records available
	001 28,909 Last reported odometer reading

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 5/2/24 at 8:29:06 AM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

CARFAX Additional History Not all accidents / issues are reported to CARFAX	Summary
Total Loss	No Issues
No total loss reported to CARFAX.	Reported
Structural Damage	No Issues
No structural damage reported to CARFAX.	Reported
Airbag Deployment	No Issues
No airbag deployment reported to CARFAX.	Reported
Odometer Check	No Issues
No indication of an odometer rollback.	Indicated
Accident / Damage	No Issues
No accidents or damage reported to CARFAX.	Reported
Manufacturer Recall Check with an authorized Porsche dealer for any open recalls.	No Recalls Reported
Basic Warranty No data reported to CARFAX.	No Data Reported

CARFAX Title History	Summary
Damage Brands Salvage Junk Rebuilt Fire Flood Hail Lemon	No Problem
Odometer Brands Not Actual Mileage Exceeds Mechanical Limits	No Problem

CARFAX Detailed History

ate	Mileage	Source	Comments
1/05/1999		Oregon Motor Vehicle Dept. Portland, OR	Title issued or updated
8/27/2002	26,000	Oregon Inspection Station	Passed emissions inspection
01/17/2018	27,089	Oregon Motor Vehicle Dept. Roseburg, OR	Odometer reading reported
03/27/2018		Oregon Motor Vehicle Dept. Roseburg, OR	Title issued or updated - Registration issued or renewed - New owner reported
11/21/2019	27,664	Oregon Motor Vehicle Dept. Lake Oswego, OR	Odometer reading reported
11/27/2019		Oregon Inspection Station	Passed emissions inspection
12/30/2019		Oregon Motor Vehicle Dept. Lake Oswego, OR	Registration issued or renewed
02/14/2020		Oregon Motor Vehicle Dept. Lake Oswego, OR	Vehicle purchase reported - Title issued or updated
08/28/2020	28,249	Grand Prix Motors, Inc. Portland, OR † 5.0 / 5.0 5 Verified Reviews	Vehicle offered for sale
11/12/2020		Oregon Motor Vehicle Dept. Lake Oswego, OR	Registration issued or renewed
04/13/2021		Maine Motor Vehicle Dept. Cape Elizabeth, ME	Registration issued or renewed - Vehicle color noted as Orange
)5/24/2021	28,446	California Inspection Station Los Angeles, CA	Passed emissions inspection
)9/22/2022	28,503	Pennsylvania Motor Vehicle Dept.	Title issued or updated

24, 9:29 AM		CARFAX Vehicle History Report fo Bryn Mawr, PA	r this 1984 P O	DRSCHE 911 CARRERA: WP0AB0911ES122095
10/20/2023	28,908	Porsche Main Line Newtown Square, PA 610-886-1000	×	Vehicle serviced - Maintenance inspection completed
10/31/2023	28,909	Porsche Main Line Newtown Square, PA 610-886-1000 4.9 / 5.0 494 Verified Reviews 1,046 Customer Favorites	×	Vehicle serviced
12/19/2023		Pennsylvania Motor Vehicle Dept. Bryn Mawr, PA		Registration issued or renewed
	Have O	uestions? Please visit ou	· Help Ce	enter at www.carfax.com.

CARFAX Glossary

New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:


facebook.com/CARFAX





CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2024 CARFAX, Inc., part of S&P Global. All rights reserved. 5/2/24 8:29:06 AM (CDT)

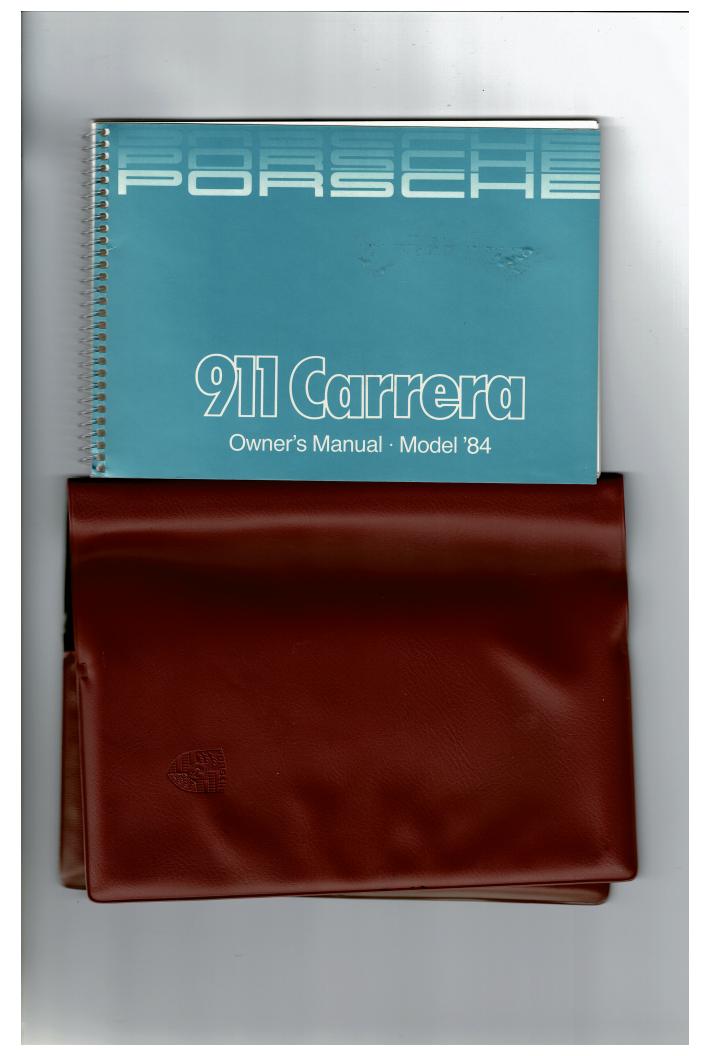

Warranty & Maintenance · Model '84

DRSC





WARRANTY VOUCHER

4


for the new 1984 Porsche automobile. Issued by the Porsche Audi Division of Volkswagen of America, Inc.

The warranty begins on the date of first			
use of the vehicle or its delivery to the first retail purchaser, namely on:	A23-A98		WPORED 91 1 ES122095
10 17 84 Month Day Year	Continenta, Parsche/Audi 2002 © W Stamp of in St	2.	911 340
(to be filled in by authorized dealer) Speedometer Replacement	authorized Porsche dealer	3. 4.	93021-64E 91568-74E L811 YA
Speedometer Replacement	XXXXXXX		LOII IU
Month Day Year (to be filled in by authorized dealer)		5. 6.	CO2 E13 395 409 469 473 650
	Stamp of authorized Porsche dealer		
At Mileage	KXXXXXX	XXX	XXXXXXXXXXXXXXXXXXX
Terms of New Vehicle Warranty, Anti C	corrosion Warranty, Emis-	$(\Lambda V \Lambda V)$	ehicle Identification Codes:

sion Control System Warranty, Emissions Performance warranty, and California Emission Control System Warranty are printed on the following pages.

Present this voucher to an authorized Porsche dealer if warranty service is required.

- 1. Vehicle Identification No.
- 2. Type
- 3. Engine Code/Engine No.
- 4. Paint No. / Interior
- 5.-7. Optional Equipment

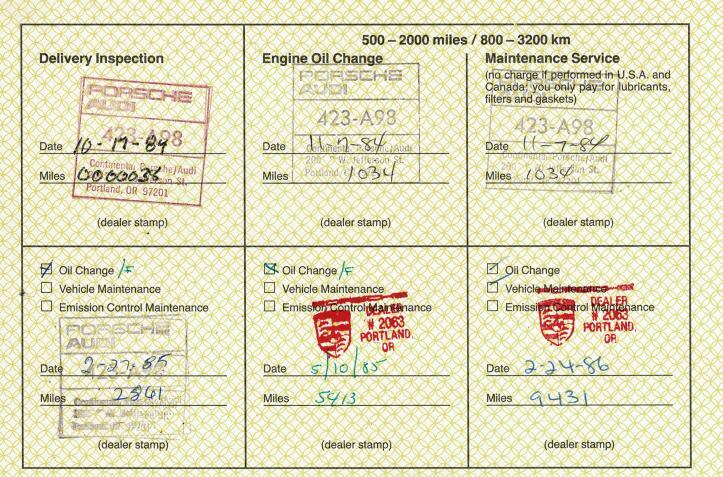

Fill in date and mileage. Only check off type of service performed.

Oil Change	Oil Change	Oil Change
Vehicle Maintenance	Vehicle Maintenance	Vehicle Maintenance
Emission Control Maintenance	Emission Control Maintenance	Emission Control Maintenance
DEALER		
PORTLAND		
Date 2-21-58	Date A A A A A A A A A A A A A A A A A A A	Date
Miles Lelolog	Miles	Miles
(dealer stamp)	(dealer stamp)	(dealer stamp)
Oil Change	🗆 Oil Change	🛛 Oil Change
Vehicle Maintenance		Vehicle Maintenance
Emission Control Maintenance	Emission Control Maintenance	Emission Control Maintenance
2063		
POHTLAND, OR		
Date 10-14-86		Date A A A A A A A A A A A A A A A A A A A
Miles 17726	Miles	Miles
(dealer stamp)	(dealer stamp)	(dealer stamp)



AUDI BMW PORSCHE MINI VW MERCEDES LAND ROVER SPRINTER

Matrix Integrated (Downtown)

4000 SW Macadam Ave. Portland, OR 97239 Phone: 503-443-1141 Fax: 503-443-1142

10/2	7/2020	5:00:00PM
	Invo	bice #
	46	119

Larry Shaps

1984 Porsche 911 Carrera Red Odometer In: 28285 Odometer (

Odometer In: 28285	Odometer Out: 28287
License: - OR	VIN: WP0AB0911ES122095
	Eng: 3.2L, H6 (193CI) VIN(B)

INVOICE

Pre-purchase inspection for Vintage Aircooled Porsche; includes compression test

Outer brake pad depth; front6mm, rear	6 mm 🗸				
Brake rotor condition; frontGoodmm, re					
Tire tread depth; LF7.4mm, RF7.4		7.1 mm. 🗸			
-Brake fluid condition; Visually clean V					
1 of the 2 front oil cooler lines has been part	ially crushed (about 50%	closed), and noticed gurgling sound near ri	ight rocker panel area		
likely due to oil flow restriction in line.	1300.00 Peri		ghe rocker parter area,		
Drivers side cam hose leaking oil stage 2					
Trans fulcrum plate seeping stage 1		1500.00			
Left rear brake caliper has minor to moderate		. /			
Front cat shield bracket is broken but still hol	ding secure right now	(20.87)			
Passenger side washer nozzle is inop, maybe	clogged. choused				
All 4 side markers are out, possibly purposeful	Il (people like the look of	them off sometimes) 🗸			
Left license plate light is out					
Seat belt warning inop (possibly purposeful)					
Mirror switch only works side to side. Switch	is likely bad				
Vehicle has R134 A/C conversion					
Compression and leakdown numbers:			· · · · · · · · · · · · · · · · · · ·		
-Cyl 1: 190 psi 4% leakdown	oner 10 %	burne di			
-Cyl 2: 195 psi 5% leakdown		Jeer.			
-Cyl 3: 195 psi 3% leakdown					
-Cyl 4: 195 psi 7% leakdown					
-Cyl 5: 195 psi 2% leakdown					
-Cyl 6: 200psi 2% leakdown					
Cosmetic:					
-Several rock chips on hood. up mel.	imer				
-Right door and rear fender appear to be repai		ent. Low clev cost pob.	2010.		
		3			
-Battery tests good @ 12.55v, 823CCA out of 9)00CCA 🛩				
-Alternator tests good at 14.35v 🗸					
-Starter voltage normal at 11.19v 🐦					
Labor: \$551.00	Parts: \$0.00	Sublet:\$0.00	Job Total: \$551.00		
Leakdown (during compression)					
Completed. Numbers recorded above.					
Labor: \$104.00	Parts: \$0.00	Sublet:\$0.00			
	· ur cs. \$0.00	Subici. 30.00	Job Total: \$104.00		

REPAIR & PERFORMANCE MATRIX AATRIXINTEGRATED.C

AUDI BMW PORSCHE MINI VW MERCEDES LAND ROVER SPRINTER

Matrix Integrated (Downtown)

4000 SW Macadam Ave. Portland, OR 97239 Phone: 503-443-1141 Fax: 503-443-1142

10/27/2020 5:00:00PM Invoice # 46119

Larry Shaps

1984 Porsche 911 Carrera Red

Odometer In: 28285 License: - OR

Odometer Out: 28287 VIN: WP0AB0911ES122095 Eng: 3.2L, H6 (193CI) VIN(B)

INVOICE

Continued From Previous Page

Recommended Work

07/31/2020 R&R broken cat bracket

Service Advisor: Blair, Jesse

By associating with Matrix Integrated Inc (MII), I; authorize to pay for all parts/services, acknowledge/agree that no inspection/diagnosis can reveal all current/potential issues which might be experienced with vehicle, understand a mechanic's lien may be placed on vehicle to secure any unpaid balance due for parts/services, understand that I will not be entitled to recover from MII any damages to property or for any other

loss/consequential/incidental damages, am satisfied with the parts/services rendered, allow MII staff to operate my vehicle at my own risk. Any warranties on parts sold are those made by the manufacturer and we(MII) the seller hereby expressly disclaim all warranties either expressed or implied, and we neither assume nor authorize any others to assume for us any liability in connection with the sale/install of the parts. 12 month warranty work has to be performed in our shop; no warranty on client supplied parts. All parts left behind become MII's. Some parts are for off-road use only; check local laws. At our discretion; Parts can be returned for credit within 30 days of purchase, subject to 20% restocking fee; \$55/day vehicle storage fee. Sign on this page.

 Labor Total:	\$655.00
Parts Total:	\$0.00
Sublet Total:	\$0.00
Shop Supplies:	\$0.00
HazMat:	\$0.00
Sub Total:	\$655.00
Tax Total:	\$0.00
Grand Total:	\$655.00
Balance Due:	\$655.00

DATE.....

Estimate

\$178

SIGNATURE.....

www.matrixintegrated.cc Page 2

Sublime Silverlake 4025 Fountain Ave. Los Angeles, CA. 90029 Phone: 323-522-6447 Independent Porsche Service

16668

Invoice from History

Printed Date: 04/26/2024	Work Completed:	05/27/2021
1984 Porsche - 911 Carrera - 3.2L, H6 (193CI) VIN(B)	

Lic # : Odometer In: 28446

VIN	#		
VIIN	Ħ	•	

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Ext
Headlight Assembly -	H-4 (European)	2.00	415.71	831.42	LIGHTING	350.00
911 631 113 00					INSTALL H4 HEADLIGHTS WITH LED BULBS	
headlight rim black		2.00	95.60	191.20	HEALIGHT RINGS IN BLACK	
911 631 933 01						175.00
H4 LED LIGHTS		1.00	135.00	135.00	CHARGE AC SYSTEM WITH DYE AND FREON	
LEDH4					ENGINE	87.50
Support Ring (Bushin Shaft Bearing	g) for Steering	1.00	27.74	27.74	ADJUST BELT TENSION ADJUST IDLE	
928 347 739 02					BODY	35.00
Chain Cover Gasket S	Set	1.00	35.65	35.65	SWITCH WIPERS	
Cover Gaskets, Nuts 10 0912 181					STEERING REMOVE AND REPLACE STEERING WHEEL BUSHING	175.00
Shop Supplies				25.51	ENGINE	437.50
					REMOVE AND REPLACE TIMING CHAIN COVER GASKETS	407.00
					INSPECTION S PERFORM INSPECTION S	70.00
					Hazardous Materials	5.00
Drg. Estimate 5.00	Revisions	0.00	Current Es	stimate 5.00	Labor:	1,330.00
					Parts:	1,246.52
					HazMat:	5.00
					SubTotal:	2,581.52
					Tax:	118.42
					Total:	2,699.94
Payments - American Express	- \$2,699.94]				Bal Due:	\$0.00
/ehicle Received: 5/13/2021						umber : 1041

amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature

Date

sublime

SUBLIME SILVERLAKE

4025 Fountain Ave. Los Angeles, CA. 90029 Phone: 323-522-6447

17198

Independent Porsche Service Invoice from History

Printed Date: 04/26/2024 Work Completed: 01/13/2022

1984 Porsche - 911 Carrera - 3.2L, H6 (193C	I) VIN(B)
Lic # :	Odometer In: 28908

\/I	Ν	#	•	
v	1 1	Ħ		

Part Description	/ Number	Qty	Sale	Ext	Labor Description		Ext
BRAD PENN ENGIN 20W50	EOIL	10.00	12.56	125.60	radio install blapunkt		300.00
OIL FILTER		1.00	25.56	25.56	service		175.00
OC54					oil change service		
Shop Supplies				7.14	-remove dip stick from tank		
					clutch clutch adjustment - grabs too high		87.50
							- 1-
					general Hazardous Materials		n/c 5.00
							5.00
Org. Estimate 5.00	Revisions	0.00	Current Es	timate 5.00		Labor:	562.50
						Denter	
						Parts:	158.30
						Parts: HazMat:	158.30 5.00
						HazMat:	5.00
						HazMat: SubTotal:	5.00 725.80
[Payments - American Express	s - \$740.84]					HazMat: SubTotal: Tax:	5.00 725.80 15.04
						HazMat: SubTotal: Tax: Total: Bal Due:	5.00 725.80 15.04 740.84 \$0.00
Vehicle Received: 1/7/2022		e along with the nece	ssary material a	nd hereby gra	nt you and/or your employees permission to operate the c	HazMat: SubTotal: Tax: Total: Bal Due: Customer	5.00 725.80 15.04 740.84
Vehicle Received: 1/7/2022 I hereby authorize the abo described on street, highv	ove repair work to be done ways or elsewhere for the	purpose to testing ar	nd/or inspection.	An express n	nt you and/or your employees permission to operate the c nechanic's lien is hereby acknowledged on above car or tr first. Warranty work has to be performed in our shop & c	HazMat: SubTotal: Tax: Total: Bal Due: Customer ar or truck herein uck to secure the	5.00 725.80 15.04 740.84 \$0.00



AUDI BMW PORSCHE MINI VW

MERCEDES LAND ROVER SPRINTER

Matrix Integrated (Downtown)

4000 SW Macadam Ave. Portland, OR 97239 Phone: 503-443-1141 Fax: 503-443-1142 11/25/2019 5:00:00PM Invoice #

43946



1984 Porsche 911 Carrera Red

Odometer In: 27735 License: - OR Odometer Out: 27735 VIN: WP0AB0911E5122095 Eng: 3.2L, H6 (193CI) VIN(B)

INVOICE

** waiting **

Client states the blinkers are inop...advise

Inspected fuse box. Found some fuses are old and some corrosion is starting to build up. Removed all fuses - cleaned contact points and tightened contacts, tighten all securing screws on fuse boxes. Replaced 10 fuses based off condition. Blinkers are functioning normally at this time.

Note front and rear marker lights don't come on. It's possible somebody pulled the bulbs intentionally. Additional diagnosis will be needed.

Part Number	Description		Quantity	Sale	Extended
073002508	White 8amp ceramic motor fuse		5.00	\$0.72	\$3.60
073002516	Red 16amp ceramic motor fuse		4.00	\$0.89	\$3.56
073002525	Blue 25amp ceramic motor fuse		1.00	\$0.89	\$0.89
Labor: \$130.00	Parts: \$8.05	Sublet:\$0.00		Job Tota	al: \$ 138.05

-Rear deck lid shocks are weak

-Horn button is falling off. Looks like a broken clip. Removed horn button and replaced clip and horn button is now secure

-Engine light works. Headlight switch must be in parking lights "on" position.

-Hood light has a bad or dirty contact point on the switch under the hood. Will work if fiddling with switch. Will need to remove switch and clean as next step. Was able to get it working pretty consistently by actuating it several times without disassembly.

-Removed clock. Confirmed power and ground. Recommend sending out for repair. Re-installed and clock is working for the time being.

-A/C compressor works (R134 conversion done). Charge seems to be low. Recommend evac and recharge is next step.

Part Number	Description			Quantity	Sale	Extended
321 419 779	Clip			1.00	\$5.50	\$5.50
Labor: \$78.00		Parts: \$5.50	Sublet:\$0.00		Job Tot	al: \$ 83.50

	A the second	And a lot of the second s
Service Advisor: Blair, Jesse	Labor Total: Parts Total:	\$208.00 \$13.55
By associating with Matrix Integrated Inc (MII), I; authorize to pay for all parts/services,	Sublet Total: Shop Supplies:	\$0.00 \$4.16
acknowledge/agree that no inspection/diagnosis can reveal all current/potential issues which might be experienced with vehicle, understand a mechanic's lien may be placed on vehicle to secure any unpaid balance due for parts/services, understand that I will not be	HazMat:	\$0.00
entitled to recover from MII any damages to property or for any other loss/consequential/incidental damages, am satisfied with the parts/services rendered, allow	Sub Total:	\$225.71
MII staff to operate my vehicle at my own risk. Any warranties on parts sold are those made by the manufacturer and we(MII) the seller hereby expressly disclaim all warranties	Tax Total:	\$0.00
either expressed or implied, and we neither assume nor authorize any others to assume for	Grand Total:	\$225.71
us any liability in connection with the sale/install of the parts. 12 month warranty work has	Balance Due:	\$0.00
to be performed in our shop; no warranty on client supplied parts. All parts left behind become MII's. Some parts are for off-road use only; check local laws. At our discretion; Parts can be returned for credit within 30 days of purchase, subject to 20% restocking fee; \$55/day vehicle storage fee. Sign on this page.	VISA	COSC WER
SIGNATURE	DATE	

Payment(s) 11/25/2019 5:00:14PM

\$225.71

Visa

www.matrixintegrated.cc





AUDI BMW PORSCHE MINI VW MERCEDES LAND ROVER SPRINTER

Matrix Integrated (Downtown) 4000 SW Macadam Ave. Portland, OR 97239 Phone: 503-443-1141 Fax: 503-443-1142

8/3/2020 5:00:00PM Invoice # 45496

1984 Porsche 911 Carrera Red

Odometer In: 28230 License: - OR

Odometer Out: 28231 VIN: WP0AB0911ES122095 Eng: 3.2L, H6 (193CI) VIN(B)

INVOICE

Change oil/filter						
-Performed.				Quantity	Sale	Extended
art Number	Description			1.00	\$15.83	\$15.83
30 107 764 03	Oil Filter Spin-On	DANED and cuathe	tic: Bulk	10.50	\$5.89	\$61.85
050 Labor: \$145.00	Total/Elf Race Sh	20w50 non-synthe Parts: \$77.68	Sublet:\$0.00		Job Total	: \$222.68
134 a/c discha	rge/recharge se	rvice; A/C inop p	er client			- Contraction
Performed a/c eval	c and recharge, syste	em only had .12Kg of	freon. System passed vacuum te	st. Recharged system.	Cala	Extended
11 101 - 1 - 1 - 3/1A / 3/2	Description			bi bind the bit	Sale	\$28.00
art Number R134AJ/Freon	R134 freon: per	kg		0.80 0.15	\$35.00 \$24.93	\$28.00
00-830-00-18	PAG A/C Lubrica	nt for R134A, w/ dy	re; 80Z	0.15		
Labor: \$174.00		Parts: \$31.74	Sublet:\$0.00	and a star and a star of the star of the star star and the star of the star of the star of the star of the star	Job Tota	1: \$205.74
R&R rear hatch	struts / engine (over				
-Replaced hatch str				Quantity	Sale	Extended
Part Number	Description	() Managaran ana ang kasa		2.00	\$34.21	\$68.42
911 512 331 01	Hatch Strut Real				Job Tota	1: \$184.47
Labor: \$116.00	and the second	Parts: \$68.42	Sublet:\$0.00		500 100	
Brake system fl	ush (fluid extra)	; includes bleed				
Performed.	a state and a second second	and the second second	241.5 %	Quantity	Sale	Extended
Part Number	Description	i and a start of the	G. I. d. and little	1.00	\$20.16	\$20.16
706232	ATE Typ200 Dol	4 performance bra	ke fiuld; per iker		Barrish in Charles and	1: \$237.66
Labor: \$217.50	and have been	Parts: \$20.16	Sublet:\$0.00	Presses - Parlamenter Landrage province	300 100	
Reconnect wind	shield washer h	ose	Constraint Marine Marine		not ourantly	leaking at
	tshield washer suction ashers, driver side w		np. Filled with washer fluid to ch functioning, passenger side is in			Extende
Part Number	Description	All and a second se		Quantity	Sale	EALEDUE
Jublia I Latillation	The product	er state to the v	www.matrixintegrated.cc			
			Dana 1			All states of the second





Porsche Production Specifications

The Porsche vehicle with the identification number listed below was manufactured with the following assembly specifications:

WP0AB0911ES122095

Model Year/Type 1984 911 Carrera Coupe

Production Completion Date 9/14/1984

Manufacturer's Suggested Retail Price (MSRP) Information Not Available

Exterior Paint Color/Code Kiln Red Metallic/X3

Optional Equipment

US Standard Emissions Speedometer w/ 2 Scales (KPH/MPH) Blaupunkt Radio 'Monterey' Automatic 2 Point Seat Belts - Rear Increased Side Door Strength License Brackets - F/R Forged Alloy Wheels Leather Sport Seats - L/R Cruise Control Without Compressor & Tire Pressure Gauge Engine Type M930/21

Displacement 3.2 Liter

Transmission Type G915/68

Interior Material Color/Code Black Leather/YA

Black Roofliner Spoiler - F/R Sport Shock Absorbers Symbols for Controls Alarm System Without Rear Fog Light Electric Sliding Sunroof Without Vehicle Identification Plate Pirelli Tires

Klaus Zellmer President and Chief Executive Officer Porsche Cars North America, Inc.