



SANTA BARBARA AUTO GROUP
402 S Hope Avenue Santa Barbara, CA 93105
Phone: (805) 682-2000

EPA CAL000331804 | EPA CAL000303744
BAR REG ARD233549 | BAR REG ARD233548

SERVICE DEPARTMENT HOURS
8:00 a.m. to 5:00 p.m.
Monday - Friday

| | |
|-------------------------------|-----------------|
| R/O Open Date | R/O Number |
| 03/05/25 | 6144607/1 |
| R/O Close Date | Status |
| 03/19/25 | |
| Mileage In | Mileage Out |
| 15038 | 15039 |
| Service Advisor / Tag # | |
| SARAH GREENE/4051 | |
| Vehicle Identification Number | |
| 216599 | |
| Delivery Date | In-Service Date |
| 00/00/00 | 00/00/00 |
| Color | License Number |
| | |

SANTA BARBARA AUTO GROUP
402 S. Hope St.
Santa Barbara, CA 93105

| | | | | | |
|--------------------|---------|-------|------|--|--|
| Year | Make | Model | Body | | |
| 1964 | PORSCHE | 356-C | | | |
| INVENTORY: U10324C | | | | | |

| DESCRIPTION OF SERVICE AND PARTS | AMOUNT |
|---|----------|
| #1 - PO SAFETY: USED CAR/PRE-PURCHASE SAFETY INSPECTION RENE FROM SALES PERFORM SAFETY INSPECTION. Caused by Safety inspection. Tech: PAULO MONROY(111) Sub Total: Labor: .00 Parts: .00 Total: .00 Performed safety inspection. Found tires to be more than 6 years old. Found slight body damage on front fenders. Right side of vehicle has been repainted. All other functions working as designed. | Internal |
| #2 - PO ENG: ENGINE MINOR REPAIR RENE FROM SALES STATES PERFORM LEAK-DOWN TEST AND LIST RESULTS. Caused by Cylinder test. Tech: PAULO MONROY(111) Sub Total: Labor: .00 Parts: .00 Total: .00 Performed compression test. Cylinder 1: 103PSI Cylinder 2: 105PSI Cylinder 3: 115PSI Cylinder 4: 105PSI | Internal |
| #3 - PO CARB: CARB Caused by CARB Tech: PAULO MONROY(111) | |

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

NOTICE TO CONSUMER:

I acknowledge notice and oral approval of any additional customer of warranty work performed and/or increase in the original estimate price. I also acknowledge and approve all repairs as itemized and/or and/or receipt of vehicle. I also acknowledge receipt of additional consumer warranty and service information contained in the Parts and Service Warranty Disclaimer.

ORIGINAL
ESTIMATE \$ _____
CUSTOMER SIGNATURE _____

AUTHORIZED
REVISED
ESTIMATE \$ _____

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.


X

| | |
|-----------------------|--|
| LABOR | |
| PARTS | |
| DEDUCTIBLE | |
| SUBLET | |
| SHOP SUPPLIES | |
| HAZARDOUS MATERIALS | |
| SALES TAX OR TAX I.D. | |
| SPECIAL ORDER DEPOSIT | |
| DISCOUNTS | |
| TOTAL DUE | |



115 psi

105 psi

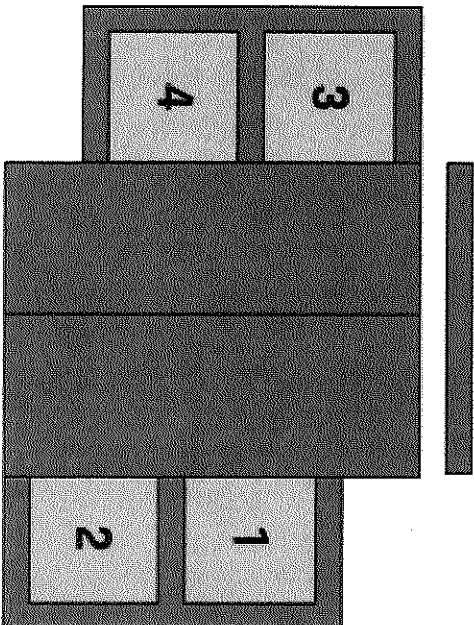

105 psi

105 psi

B4 (classic)
356 912
914

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105-0000
(805)962-8015

INVOICE: 039361
COMPLETED: 12/14/01 14:07:02
ADVISOR: PAULA
ACCOUNT #: 14632 Page: 1

CAL000001214

INVOICE FOR SERVICES

LICENSE MY 356C
VEHICLE 1964 PORSCHE 356C
V.I.N.
MILES 11488
REF:

The following parts were used when servicing your vehicle:

| Quan. | Part # | Description | Charge | Extended |
|-------|----------------|----------------------------|---------|----------|
| 1.00 | 546.07.827 | OIL FILTER | 9.95 | 9.95 |
| 2.00 | 616.104.951.00 | VALVE COVER GASKET | 4.00 | 8.00 |
| 4.50 | GTX | MOTOR OIL, 20-50WT CASTROL | 2.50 | 11.25 |
| 1.00 | 01 001 | IGNITION POINTS | 6.30 | 6.30 |
| 2.00 | 539.01.152 | SUMP GASKET | 0.60 | 1.20 |
| 4.00 | W6BC | SPARK PLUG | 2.40 | 9.60 |
| 1.00 | 999.113.012.50 | PULLEY SEAL | \$33.91 | 6.00 |
| 4.00 | 12X16MM AL | SEALING WASHER | 0.40 | 1.60 |
| 0.50 | SWEPCO 90 WT. | GEAR OIL | 6.00 | 3.00 |
| 2.00 | 8X30MM | BOLT | 0.40 | 0.80 |
| 2.00 | 8MM | NUT | 0.30 | 0.60 |
| 10.00 | 6MM | NUT | 0.15 | 1.50 |

The work performed, and the charges, are:

MINOR SERVICE:

260.00

- Change oil and filter.
- Adjust valves. All were tight.
- Check fluid levels.
- Lubricate chassis.
- Check compression: 90, 100, 85, 80
- Scope check engine.
- Replace spark plugs.
- Replace ignition points. Set dwell and timing.
- Balance and adjust carburetors.
- Check all lights. Repair poor connection in left rear brake light.
- Repair fuel leaks at carburetor inlet fittings.

Technician: VAL

CHECK ENGINE OIL LEAKS.

160.00

- Oil pressure switch was loose. Tightened.
- Sump screen leaking. R & R and replace gaskets.
- Replace rear crankshaft seal.
- #2 intake pushrod tube seal is leaking at case end.
Retainer for air guide plate under right side cylinders was resting on lower part of pushrod tube instead of on crankcase. We were able to reposition retainer back to

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105-0000
(805)962-8015

INVOICE: 039927
COMPLETED: 04/11/02 11:53:19
ADVISOR: JOE
ACCOUNT #: 14632 Page: 1

CAL000001214

PRICE FOR SERVICES

LICENSE MY 356C
VEHICLE 1964 PORSCHE 356C
V.I.N.
MILES 11684
REF:

The following parts were used when servicing your vehicle:

| Quan. | Part # | Description | Charge | Extended |
|-------|--------|-----------------------------|--------|----------|
| 1.00 | 19L-50 | BATTERY - 50 MONTH WARRANTY | 54.95 | 54.95 |
| 2.00 | NOCO | TERMINAL PROTECTORS | 0.50 | 1.00 |
| 1.00 | SR 21X | REBUILT STARTER | 180.00 | 180.00 |

The work performed, and the charges, are:

CHECK HARD STARTING. CONVERT FROM 8V BACK TO 6V SYSTEM. 176.00

---Replace battery.

---Replace starter motor and support bushing.

Technician: VAL

AGS REBUILDERS:

36.00

---Adjust voltage regulator for 6 volt operation.

This service was sublet to another vendor

CHECK ROUGH RUNNING.

66.00

---Scope check engine.

---Adjust ignition timing. Balance and adjust carburetors.

Technician: VAL

| | | |
|---------------------|----|--------|
| Parts: Taxable | \$ | 235.95 |
| Labor: Non-taxable | \$ | 242.00 |
| Sublet: Non-taxable | \$ | 36.00 |
| SUBTOTAL: | \$ | 513.95 |
| Tax: | \$ | 18.29 |
| TOTAL: | \$ | 532.24 |
| BALANCE: | \$ | 532.24 |

All parts and labor are warranted for 12 months or 12000 miles, whichever comes first and unless otherwise stated on this repair order. Warranty valid only if vehicle is returned at customers expense to our service department for adjustment. warranty will be voided by overheating, or lack of lubrication. A buyer of this product in California has the right to have this product serviced or repaired during the warranty period. The warranty period will be extended for the number of whole days that the product has been out of the buyer's hands for warranty repairs. If a defect exists within the warranty period, the warranty will not expire until the defect has been fixed. The warranty period will also be extended if the warranty repairs did not remedy the defect and the buyer notifies the seller or manufacturer of the failure of the repairs within 60 days after they were completed. If, after a reasonable number of attempts, the defect has not been fixed, the buyer may return the product for a replacement or a refund, subject, in either case, to a deduction of a reasonable charge for usage. This time extension does not affect the protection or remedies the buyer has under other laws. -----

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105-0000
(805)962-8015

CAL000001214

INVOICE: 039927
COMPLETED: 04/11/02 11:53:19
ADVISOR: JOE
ACCOUNT #: 14632 Page: 2

Repairs accepted by: _____ Date _____
Received \$ 532.24 Cash Check No. _____ Credit card _____

THANK YOU FOR ALLOWING US TO SERVICE
YOUR CAR.

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

64 PORSCHE 356C

License # MY 356C

Repair Order # 49174

Mileage: 12950

Inv Date: July 1, 2008 @ 10:48am

VIN:

Color:

Service Writer:

Engine:

Unit #:

Status: Complete

Transmission:

PO #

Driver: Kaufmann, Ernest

Mfg. Date:

| Vehicle Problems | Requests for Service | Services Performed | Qty | Price | Ext |
|---|----------------------|--------------------|------|-------|--------|
| Check gas smell. has been sitting. | | | | | 93.75 |
| Labor Service - . | | | | | |
| Check for gas smell. | | | | | |
| —Found seeping fuel hose at fuel pump inlet. | | | | | |
| —Replace all engine compartment and undercar fuel hoses. (Techs: JOE) | | | | | |
| New | FT. 7MM BRAIDED | Fuel hose | 5.00 | 3.00 | 15.00 |
| New | MINI | Hose clamp | 9.00 | 1.95 | 17.55 |
| New | 131.261.275A | Fuel filter | 1.00 | 2.45 | 2.45 |
| | | | | | 187.50 |
| Labor Service - . | | | | | |
| Replace leaking rear axle boots. (Techs: JOE) | | | | | |
| New | 111.598.021A | Axle boot | 2.00 | 29.95 | 59.90 |
| New | SWEPCO 90 WT. | Gear oil | 3.00 | 7.95 | 23.85 |

Repair Order Summary:

| | |
|-------|----------|
| Parts | \$118.75 |
| Labor | \$281.25 |

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Customer acknowledges receipt of merchandise and services.

| | |
|-----------------|----------|
| Sub Total | \$400.00 |
| Sales Tax (DEF) | \$9.23 |

Discard old parts

| | | | |
|--------------------|----------|--------------|-----------------|
| Original Estimate: | \$413.92 | Total | \$409.23 |
|--------------------|----------|--------------|-----------------|

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

64 PORSCHE 356C

License # MY 356C

Repair Order # 53931

VIN:

Mileage: 13494

Inv Date: August 24, 2011 @ 11:03am

Engine:

Color:

Service Writer:

Transmission:

Unit #:

Status: Complete

PO #

Driver: Kaufmann, Ernest

Mfg. Date:

| Vehicle Problems | Requests for Service | Services Performed | Qty | Price | | Ext |
|--|----------------------|-------------------------------|------|--------|-------|--------|
| Change engine oil and filter. | | | | | | |
| Lubricate chassis. | | | | | | |
| Labor Service - | | | | | | 97.50 |
| —Change engine oil and filter. | | | | | | |
| —Lubricate chassis. | | | | | | |
| —Check fluids. (Techs: JOE) | | | | | | |
| New | BRAD PENN R 20W-50 | Brad Penn Racing 20W-50 green | 6.00 | 7.95 | | 47.70 |
| New | 546.07.827 | Oil filter | 1.00 | 15.75 | | 15.75 |
| New | HAZ. WASTE | Hazardous waste fee | 1.00 | 3.00 | | 3.00 |
| New | SWEPCO 210 | Synthetic gear oil, pint | 1.50 | 18.95 | 13.05 | 15.38 |
| Labor Service - | | | | | | 97.50 |
| Check lights. | | | | | | |
| —No brake lights or rear turn signals. | | | | | | |
| —Check electrics. Found bulb broken and wire broken to left side. Bad bulb socket on right side. | | | | | | |
| —Replace bulbs. Repair broken wire. Shim right side bulb. | | | | | | |
| —Lights are working now but right side is temporary. | | | | | | |
| —Estimated cost to replace bulb socket: \$200. | | | | | | |
| —Estimated cost to replace light assembly: \$240. (Techs: JOE) | | | | | | |
| New | N.17.731.1 | Bulb 6v 18w | 2.00 | 2.60 | | 5.20 |
| Labor Service - | | | | | | 32.50 |
| Replace torn fan belt. (Techs: JOE) | | | | | | |
| New | 10X825 | V-belt | 1.00 | 15.68 | 5.83 | 9.85 |
| Labor Service - | | | | | | 65.00 |
| Car has a hard pull to left. | | | | | | |
| —Check front suspension. Check tire pressures. Test drive. No help. | | | | | | |
| —Swap front tires. No help. | | | | | | |
| —Next step is to check alignment. | | | | | | |
| Note: Tires are 13 years old and should be replaced. (Techs: JOE) | | | | | | |
| Labor Service - | | | | | | 325.00 |
| Check and adjust alignment (Techs: HENRY) | | | | | | |
| Check grinding/sticking tachometer. | | | | | | |
| Labor Service - | | | | | | 260.00 |
| Check noisy tach. | | | | | | |
| —R & R and test tachometer. Seems OK. Needs tach cable. | | | | | | |
| —Replace tach cable. (Techs: JOE) | | | | | | |
| New | FENDER | Washer | 2.00 | 0.50 | | 1.00 |
| New | 644.741.311.01 | Tach cable | 1.00 | 166.00 | 71.00 | 95.00 |
| Engine turns over but is hard to start after sitting. | | | | | | |
| Labor Service - | | | | | | 195.00 |
| Check hard start. | | | | | | |
| —Started well for us. | | | | | | |
| —Replace worn ignition points. | | | | | | |
| —Distributor is not advancing. | | | | | | |
| —Remove and replace distributor with aftermarket unit. | | | | | | |
| —Set dwell and timing. | | | | | | |
| (Techs: JOE) | | | | | | |
| New | 01 001 | Ignition points | 1.00 | 16.16 | 5.66 | 10.50 |
| New | VW06 | Ignition distributor | 1.00 | 93.60 | | 93.60 |

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

64 PORSCHE 356C

VIN:
Engine:
Transmission:

License # MY 356C

Mileage: 13494
Color:
Unit #:
PO #
Mfg. Date:

Repair Order # 53931

Inv Date: August 24, 2011 @ 11:03am

Service Writer:
Status: Complete
Driver: Kaufmann, Ernest

Warranty

All repair work is warranted for 24 Months or 24,000 Miles, Unless Specified Otherwise.

Repair Order Summary:

| | |
|---------|------------|
| * Parts | \$249.28 |
| Labor | \$1,072.50 |
| Fluids | \$47.70 |

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

X

Customer acknowledges receipt of merchandise and services.

| | |
|-----------------|------------|
| Sub Total | \$1,369.48 |
| Sales Tax (DEF) | \$22.78 |

SCHNEIDER AUTOHAUS
2703 DE LA VINA
SANTA BARBARA CA 93105
(805) 962-8015

Work Order ID 53931
 Customer Number 33
 Name Kaufmann
 License MY 356C
 Year: 64
 Technician Henry
 Mileage 13494
 Time Printed 8/26/11 1:11 PM

Front : Left

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| 0.7° | 0.6° | 0.1° 1.3° |
| 4.2°* | 4.1°* | 4.5° 5.5° |
| 0.30° | 1.02°* | 0.15° 0.35° |
| | | |
| | | |
| | | |

Camber
 Caster
 Toe
 SAI
 Included Angle
 Turning Angle Diff.

Front : Right

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| 0.7° | 0.8° | 0.1° 1.3° |
| 4.2°* | 4.2°* | 4.5° 5.5° |
| 0.29° | 0.99°* | 0.15° 0.35° |
| | | |
| | | |
| | | |

Front

Cross Camber
 Cross Caster
 Cross SAI
 Total Toe
 Cross Turn Diff.

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| 0.0° | -0.2° | |
| 0.0° | 0.0° | |
| | | |
| 0.59° | 2.01°* | 0.30° 0.70° |
| | | |

Rear : Left

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| 0.3° | 0.4° | 0.2° 1.4° |
| 0.20° | 0.21° | 0.00° 0.40° |

Camber
 Toe

Rear : Right

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| 0.6° | 0.7° | 0.2° 1.4° |
| 0.20° | 0.18° | 0.00° 0.40° |



Rear

Cross Camber
 Total Toe
 Thrust Angle

| Actual | Before | Specified Range |
|--------|--------|-----------------|
| -0.2° | -0.3° | |
| 0.39° | 0.37° | 0.00° 0.80° |
| 0.00° | 0.02° | |

SCHNEIDER AUTOHAUS
2703 DE LA VINA
SANTA BARBARA CA 93105
(805) 962-8015

Work Order ID 53931
Customer Number 33
Name Kaufmann
License MY 356C
Year: 64
Technician Henry
Mileage 13494
Time Printed 8/26/11 1:10 PM

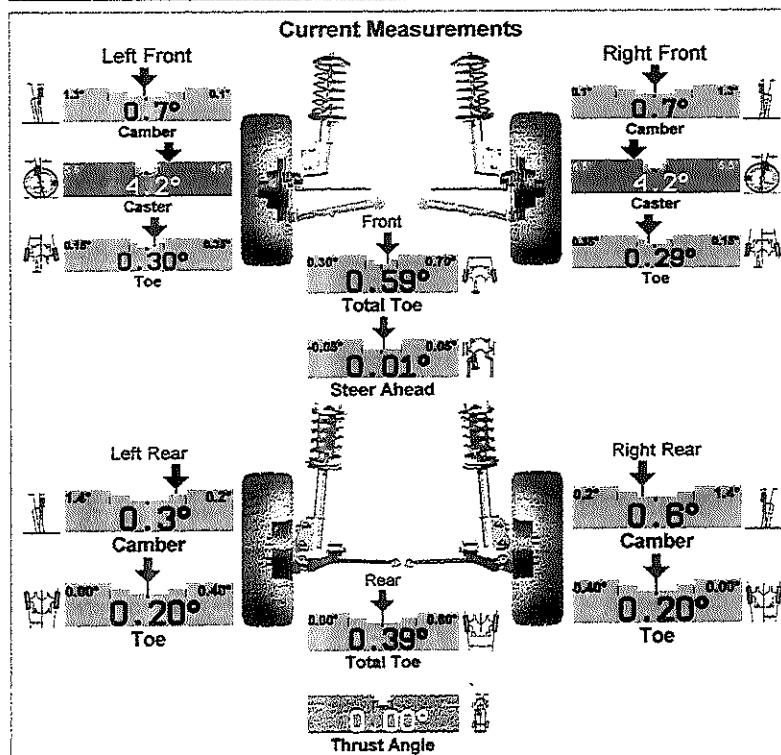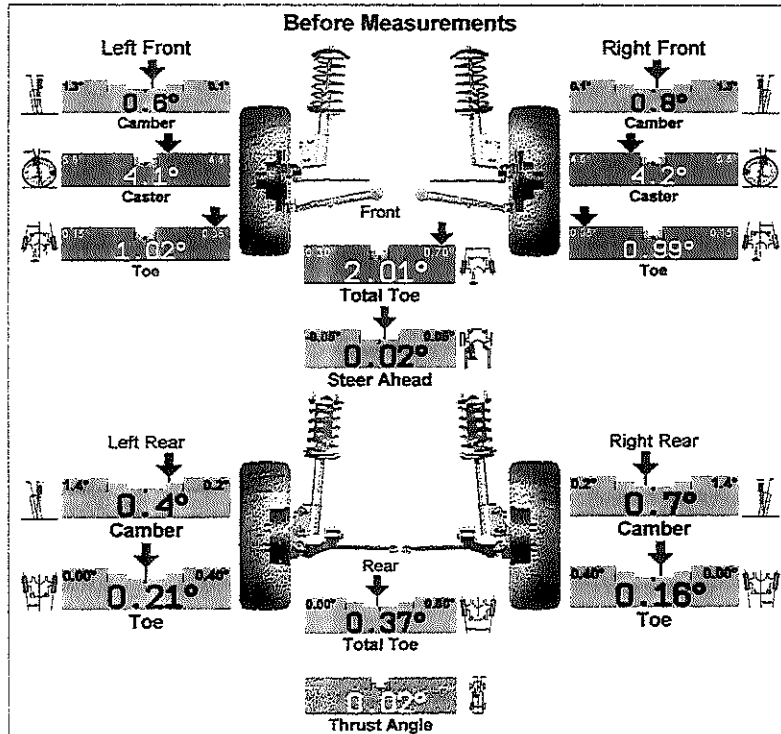

SCHNEIDER AUTOHAUS

2703 De La Vina Street
 Santa Barbara, CA 93105
 (805) 962-8015
 BAR ARDO96296 073104
 CAL 000 001 214

Invoice # 62870

64 PORSCHE 356C

VIN:
 Engine:
 Trans:

License # MY 356C

ODO In:14276 Out: 14279

Color:

Mfg. Date:

Unit #

Inv Date: 10/31/2016

Promised: 10/31/2016 @ 5:00pm

Service Writer:

Status: Complete

Driver: Kaufmann, Ernest

PO #

| Vehicle Problems | Requests for Service | Services Performed | Qty | Price | Ext |
|--|----------------------|------------------------|------|--------|--------|
| Towed in, check no crank, no start. | | | | | |
| Labor Service - | | | | | 112.50 |
| Check no-start: found that the battery is very low on water. | | | | | |
| —Fill battery, recharge and test. | | | | | |
| Battery needs to be replaced. battery from 08/2012. | | | | | |
| —Remove and replace battery. JOE | | | | | |
| New | DISTILLED | Water | 0.50 | 2.60 | 1.30 |
| New | VHD 1 BATTERY | Heavy duty battery 356 | 1.00 | 117.95 | 117.95 |
| New | NOCO | Terminal protectors | 2.00 | 0.95 | 1.90 |

Check for service due.

Labor Service - Minor service: 3000 mile service.

—Change oil and filter.

—Adjust valves.

—Check fluid levels.

—Lubricate chassis.

—Check battery.

—Check lights. Replace missing front park light bulb. Replace left front turn signal

bul

| | | | | | |
|-----|--------------------|--------------------------------------|------|-------|-------|
| New | BRAD PENN R 20W-50 | Brad Penn Racing 20W-50 green | 4.50 | 12.95 | 58.28 |
| New | 616.104.951.00 | Valve cover gasket | 2.00 | 8.95 | 17.90 |
| New | 546.07.827 | Oil filter | 1.00 | 24.95 | 24.95 |
| New | HAZ. WASTE | Hazardous waste fee | 1.00 | 4.00 | 4.00 |
| New | CARB DEFENDER | Driven Carb Defender fuel stabilizer | 1.00 | 14.99 | 14.99 |
| New | SWEPKO 90 WT. | Gear oil, pint, Swepeco 201 | 1.00 | 7.95 | 7.95 |
| New | N.17.717.1 | Bulb 6v 4w | 2.00 | 1.03 | 2.06 |
| New | N.17.731.1 | Bulb 6v 18w | 1.00 | 2.60 | 2.60 |
| New | 131.261.275A | Fuel filter | 1.00 | 5.50 | 5.50 |

Check oil leaks.

Labor Service -

Check oil leaks: found that the most significant leak is from the cylinder head nut

O-rings. —Remove and replace head nut O-rings. JOE

| | | | | | |
|-----|------------|------------------|------|------|------|
| New | 539.04.203 | O-ring, head nut | 8.00 | 0.95 | 7.60 |
|-----|------------|------------------|------|------|------|

Labor Service -

Leak at left axle boot.

Replace left axle boot. Remove all glue residue.

—Boot was pretty new but was not correctly installed. JOE

| | | | | | |
|-----|--------------|-----------|------|-------|-------|
| New | 111.598.021A | Axle boot | 1.00 | 33.90 | 33.90 |
|-----|--------------|-----------|------|-------|-------|

The brake fluid is old and the front brake hoses are cracked and worn.

Labor Service -

—Remove and replace front brake hoses.

—Flush and bleed brake fluid. JOE

| | | | | | |
|-----|---------------|--------------------------------|------|-------|-------|
| New | 644.42.311 | Brake hose, front | 2.00 | 41.70 | 83.40 |
| New | DOT 4 TYP 200 | Brake fluid Ate type 200 DOT 4 | 1.00 | 25.00 | 25.00 |

Check for dirt in fuel system.

Labor Service -

R & r tank sending unit. Inspect inside of fuel tank. Some slight surface rust but ok.

75.00

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

Invoice # **62870**

64 PORSCHE 356C

License # MY 356C

Inv Date: 10/31/2016

R & R fuel cock bowl, some dirt inside but not bad.
Recommended checking fuel filter in engine compartment often and replacing as
nee

| | | | | | |
|-----|----------------|--------------------|------|------|------|
| New | 914.201.891.00 | Fuel sender gasket | 1.00 | 7.95 | 7.95 |
|-----|----------------|--------------------|------|------|------|

Mice in front trunk

Labor Service -

Clean up mouse residue. 112.50

Repair chewed wire. JOE

| | | | | | |
|-----|--------------|---------------|------|------|------|
| New | NPN TERMINAL | Wire terminal | 2.00 | 1.20 | 2.40 |
|-----|--------------|---------------|------|------|------|

| | | | | | |
|-----|------------|--------|------|------|------|
| New | IN. SHRINK | Tubing | 2.00 | 0.50 | 1.00 |
|-----|------------|--------|------|------|------|

Vehicle Tire Information

Check Performed.

| | <u>Left Front</u> | <u>Right Front</u> | <u>Left Rear</u> | <u>Right Rear</u> | <u>Checked By</u> |
|-------------------|-------------------|--------------------|------------------|-------------------|-------------------|
| Tire Pressure PSI | 26 | 26 | 30 | 30 | |

Warranty

All repair work (parts and labor) is warranted for 24 Months or 24,000 Miles,
Unless Specified Otherwise.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Customer acknowledges receipt of merchandise and services.

Invoice Summary

| | |
|--------|----------|
| Parts | 329.40 |
| Labor | 1,125.00 |
| Fluids | 91.23 |

| | |
|----------------|----------|
| Sub Total | 1,545.63 |
| Sales Tax (CA) | 33.33 |

| | |
|--------------|-----------------|
| Total | 1,578.96 |
|--------------|-----------------|

SANTA BARBARA TIRE SERVICE CENTER

2701 DE LA VINA ST

Santa Barbara, CA. 93105

Phone: 805-569-2102 Fax: 805-687-2882

INVOICE**19149**

Org. Est. # 044536

BAR ARD00238359

Vehicle Received: **11/03/2016**Invoice Date: **11/07/2016**

1964 PORSCHE - 356C -

Lic #: MY 356C - CA

Odometer In : 14276

VIN #:

| Part Description / Number | Qty | Sale | Ext | Labor Description | Hours | Extended |
|--|------|--------|--------|-------------------|-------|----------|
| WEIGHTS ATD | 4.00 | 4.00 | 16.00 | COMPUTER BALANCE | 4.00 | 100.00 |
| NEW VALVE STEMS MIGHTY | 4.00 | 4.00 | 16.00 | TIRE DISPOSAL FEE | 4.00 | 20.00 |
| 195/65R15 Continental PureContact 70K Mile Warranty 1956515CONTI | 4.00 | 111.46 | 445.84 | CARRY OUT | | |

Org. Estimate 597.84 Revisions 0.00 Current Estimate 597.84

| | |
|-----------|--------|
| Labor: | 120.00 |
| Parts: | 477.84 |
| SubTotal: | 597.84 |
| Tax: | 38.23 |
| Total: | 636.07 |
| Bal Due: | \$0.00 |

[Payments - Visa - \$636.07]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature [Signature] Date _____ Time _____

Written By: LEON, OMAR - Technicians : Please Select, Technician

Page 1 of 1

Copyright (c) 2016 Mitchell Repair Information Company, LLC invhrs 7.2.15d