

Service Advisor: **Bobby Varela**

Call Us: (954) 746-0488

Message Us



1.

REMOVE AND REPLACE BRAKES - CUSTOMER SUPPLIED

\$773.66



LABOR

REMOVE AND REPLACE FRONT AND REAR BRAKES - customer supplied



PARTS

QUANTITY

EACH

TOTAL

REAR BRAKE PAD SET

1.0
\$178.58
\$178.58

BRAKE PAD SENSOR

2.0
\$23.36
\$46.72

BRAKE PAD SENSOR

1.0
\$23.36
\$23.36



2.

CHECK IDLE

Inspect idle stabilizer harness, it's been re-taped. At some point, somebody tapped in to the wire - WIRE WAS GOOD - NO REPAIRS DONE TO THE WIRE AT THIS TIME Check idle and full throttle switch, both are good Check idle issue, test various sensors, all tested good. Change idle stabilizer with new idle stabilizer to check idle hunt and investigate issue - idle stopped hunting but engine still stalled, car is idling normal now. - then reinstalled old idle stabilizer - drilled out adjustment screw and set idle to just below 1500 rpm - engine is not stalling now while a/c is on and not hunting.

\$300.00



LABOR

check idle issue



3.

CHECK WHY SPEEDO NOT WORKING

IMPULSE SENDER ON TRANSMISSION WAS FAULTY - REPLACE AND RECHECK - SPEEDO NOW WORKING

\$532.43



LABOR

REMOVE AND REPLACE IMPLUSE SENDER



PARTS

QUANTITY

EACH

TOTAL

IMPULSE SENDER SPEEDOMETER

1.0
\$277.43
\$277.43



4.

CHECK SUSPENSION - REAR

race suspension installed on car at this time - needs street suspension to solve issue

\$0.00

Show Findings

Review the following findings from the shop



🕒Preview



🕒Preview

Bobby V.

•
05/06/2025 03:22 PM

Inspect idle stabilizer harness, it's been re-taped. At some point, somebody tapped in to the wire.



🕒Preview



🕒Preview

Anthony D.

•
05/06/2025 03:33 PM

Check idle and full throttle switch, both are good



🕒Preview

Anthony D.

•
05/06/2025 03:34 PM
Front brakes installed



🕒Preview



🕒Preview
Anthony D.

•
05/07/2025 09:11 AM
Rear brakes installed



🕒Preview



🕒Preview
Anthony D.

•
05/07/2025 11:14 AM

Check idle issue, test various sensors, all tested good. Change idle stabilizer, car is idling normal now. Engine is at operating temperature and idle is within specifications. Car stalls with AC on.



🕒Preview



🕒Preview
Anthony D.

•
05/09/2025 11:51 AM
Suspension is too harsh for street driving
Anthony D.

•
05/09/2025 11:52 AM
Need to replace idle stabilizer for idle issue and need to replace vehicle speed sensor for speedo issue
Anthony D.

•
05/09/2025 11:54 AM

New speed sensor, speedometer is working properly



🕒 Preview

Anthony D.

•
05/13/2025 08:10 AM

Readjust idle stabilizer set screw, idle is a little high, but is no longer hunting or stalling with the air conditioning on
Anthony D.

•
05/13/2025 10:00 AM



Recommended Services Overview

Displayed by date created.

Urgency:

High (0)

Medium (0)

Low (0)

Not Set (3)

PAST RECOMMENDATIONS (3)

*Required

REBUILD ENGINE

\$24,236.41

ENGINE IN AND OUT

\$6,614.29

REPLACE LOWER VALVE COVER GASKETS

\$871.55

Invoice



Approved Amount:

\$1,606.09

Shop Supplies:

\$24.99

Sales Tax:

\$114.18

Total:

\$1,745.26

Balance due:

\$1,745.26



Terms of Service



Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 1 of 15
08/01/2025 1:45 PM

Kyle Stabile

1626 ne 5th street
ft. lauderdale, FL 33301
kyle@gccmiami.com
+1 305-215-1536

1990 PORSCHE 911

WP0ZZZ96ZLS451304
Engine: 3.6
Plate:
Odometer In: 85535
Odometer Out:

Advisor: Bobby Varela

Technician: Robin Hunt

GRAND TOTAL: \$3,909.95

✓ PAID

SERVICES

1 INSTALL COIL OVER SUSPENSION - CUSTOMER SUPPLIED

SUBTOTAL: \$2,913.17

LABOR

PARTS

	QTY	EACH	TOTAL
REAR STRUT MOUNT	2.0	\$372.34	\$744.68
SHIPPING	1.0	\$15.00	\$15.00
STRUT MOUNT	2.0	\$340.64	\$681.28
SHIPPING	1.0	\$13.09	\$13.09
SUPPORT RING	4.0	\$55.78	\$223.12
Shock Mounting	2.0	\$108.90	\$217.80
SUPPORT SLEEVE F	2.0	\$14.85	\$29.70
WASHER	2.0	\$13.66	\$27.32
REAR BUMPER STOP	2.0	\$30.59	\$61.18

2 PORSCHE 4 WHEEL ALIGNMENT

SUBTOTAL: \$385.00

LABOR

PERFORM PORSCHE FACTORY ALIGNMENT

3 REMOVE AND REPLACE LEFT TIE ROD ASSEMBLY

SUBTOTAL: \$331.00

LABOR

PARTS

	QTY	EACH	TOTAL
Tie Rod	1.0	\$221.00	\$221.00



Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 2 of 15
08/01/2025 1:45 PM

Terms of Service:

- 1. "YES, DO THIS WORK"
PLEASE READ CAREFULLY, CHECK ONE OF THE STATEMENTS BELOW, AND SIGN:
I UNDERSTAND THAT, UNDER STATE LAW, I AM ENTITLED TO A WRITTEN ESTIMATE IF MY FINAL BILL WILL EXCEED \$150.
 I REQUEST A WRITTEN ESTIMATE.
 I DO NOT REQUEST A WRITTEN ESTIMATE AS LONG AS THE REPAIR COSTS DO NOT EXCEED \$____. THE SHOP MAY NOT EXCEED THIS AMOUNT WITHOUT MY WRITTEN OR ORAL APPROVAL.
 I DO NOT REQUEST A WRITTEN ESTIMATE.

SIGNED _____ DATE _____

- 2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"
Foreign Affairs Motorsport staff may operate my vehicle for the purpose of testing, inspection, and delivery.

- 3. "NO PAYMENT, NO KEYS"
An express lien is acknowledged on my vehicle to secure the amount of services thereto.

- 4. "ONLINE COMMUNICATION OK"
I welcome email from Foreign Affairs Motorwerks as a means of receiving copies of my estimate, work order, and invoice.

- 5. "HERE'S MY SIGNATURE"
I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these five terms.

FLORIDA REGISTRATION: MV- 104260

12 month 12,000 mile warranty on all parts and labor unless otherwise specified.

**Shop supplies charge represents costs and profits to the motor vehicle repair facility for miscellaneous shop supplies or waste disposal.
***FS403.718 mandates a \$1.00 fee for each new tire sold in the State of Florida.
***FS403.7185 mandates a \$1.50 fee for each new or remanufactured battery sold in the State of Florida.

Authorization:

GRAND TOTAL: \$3,909.95

Total Labor: \$1,395.00
 Total Parts: \$2,234.17
 Total Fees: \$0.00
 Total Sublets: \$0.00
 Shop Supplies: \$24.99
 Sales Tax: \$255.79

✓ PAID

08/01/2025 01:45 PM
 Paid by Credit Card - AMERICAN EXPRESS
 : **\$3,909.95**

FINDINGS



Written by Robin Hunt at 07/15/2025 11:46 AM

Replacing all six bolts for the rear strut mount they're too tall, causing the mounts to be bind up




Written by Robin Hunt at 07/15/2025 12:45 PM



Written by Robin Hunt at 07/15/2025 03:22 PM

lower control arm boots open

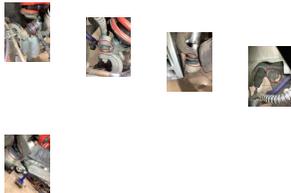


Written by Robin Hunt at 07/15/2025 03:35 PM

Replace front struts





Written by Robin Hunt at 07/15/2025 04:02 PM

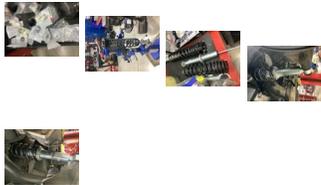

Written by Robin Hunt at 07/22/2025 09:01 AM

Left outer tire and seized could not do the alignments



Written by Robin Hunt at 07/23/2025 10:39 AM

Remove spacer from front wheels,was rubbing on the fender



Written by Robin Hunt at 07/23/2025 10:41 AM

Steering wheel shaking at 60 front wheels need balancing



Written by Robin Hunt at 07/23/2025 02:43 PM



Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 5 of 15
08/01/2025 1:45 PM

Past Recommendations

ENGINE IN AND OUT \$6614.29 +tax

**((QUOTE)) REPLACE LOWER VALVE COVER GASKETS
\$871.55 +tax**

((QUOTE)) REBUILD ENGINE \$24247.39 +tax

Attached Images:





Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 7 of 15
08/01/2025 1:45 PM





Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 8 of 15
08/01/2025 1:45 PM







Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 10 of 15
08/01/2025 1:45 PM







Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 12 of 15
08/01/2025 1:45 PM







Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 14 of 15
08/01/2025 1:45 PM






Foreign Affairs Motorwerks

2821 CENTER PORT CIRCLE
POMPANO BEACH, FL 33064
(954) 746-0488
amyv4n@gmail.com

Work Order #22436

Page 15 of 15
08/01/2025 1:45 PM

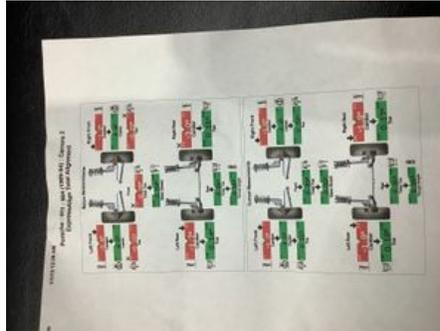

From: Pelican Parts pelican-parts-orders18882807799@pelicanparts.com
Subject: Quote, New Order 1727194753-887 is confirmed
Date: September 24, 2024 at 12:19 PM
To: kyle@gccmiami.com



ORDER CONFIRMATION

Thank you for shopping with Pelican Parts! Here are your order details.

Order ID: 1727194753-887

CUSTOMER INFORMATION

QQuote for Kyle Stabile
kyle@gccmiami.com
305-215-1536

VEHICLE INFORMATION

1991 Porsche 911 3.6L H6

SHIPPING METHOD

Ground Delivery

SHIPPING ADDRESS

Kyle Stabile
215 NE 33rd st
Oakland Park, FL 33334

BILLING ADDRESS

1626 ne 5th St
Fort Lauderdale, FL 33301

EXPECTED SHIP DATE:

Tuesday, September 24, 2024



A/C Condenser(1991 Porsche 911 Carrera 2 Coupe) (m)

Part #:	Price	Quantit y	Subtotal
993-573-011-03-M6	\$166.00	1	\$166.00



Receiver Drier

Part #:	Price	Quantit y	Subtotal
964-573-943-00-M179	\$22.25	1	\$22.25



Belt - A/C - 13 X 1085(1991 Porsche 911 Carrera 2



Coupe)(m)

Part #: 999-192-363-50-M100

Price	Quantit y	Subtotal
\$17.07	1	\$17.07



A/C Compressor with Clutch(1991 Porsche 911 Carrera 2 Coupe)(m)

Part #: 964-126-121-01-M11

Price	Quantit y	Subtotal
\$434.75	1	\$434.75

ORDER SUMMARY

SUBTOTAL \$640.07

Questions about your Order?

SHIPPING \$16.50

[CONTACT US](#)

Ground Delivery

TAX \$45.96

TOTAL \$702.53

COMMENTS

Delivery Location ; Cold Air Comfort Automotive

[Special Offers](#)

[Parts Catalog](#)

[Tech Articles](#)

[Forums](#)

[Accessories](#)

[Support](#)

PelicanParts.com

Contact Us
(310) 626-8765

Copyright 2022 Pelican Parts Inc., All rights reserved.
1600 240th Street, Harbor City, CA 90710

