



2018 911 GT3

Model Year	2018	Warranty Start Date	03-03-2018
Model Code	991810	Transmission	6-speed manual
Model Type	911 GT3	Engine	4.0-liter boxer 6
VIN	WPOAC2A9XJS175060	Exterior Color	GT Silver Metallic
Commission Number	B80697	Interior Color	Leather/Alcantara® Interior in Black i.c.w. Red Stitching
Total Retail Price*	\$166,310		

Optional equipment

Option Code	Description	Price (USD)
		\$143,600
991810	911 GT3	\$720
U2	GT Silver Metallic	\$3,480
68	Leather/Alcantara® Interior in Black i.c.w. Red Stitching	\$300
XUB	Headlight Cleaning System Covers Painted in Exterior Color	\$0
498	Deletion of Model Logo	\$2,900
XEY	LED Headlights in Black with Porsche Dynamic Light System	\$140
082	Extended Range Fuel Tank, 23.7 gal	\$2,590
474	Front Axle Lift System	\$0
486	6-speed GT Sport Manual Transmission	\$550
QR5	Chrono Package with Preparation for Lap Trigger	\$1,220
XDH	Wheels Painted in Satin Platinum	\$860
XFJ	Instrument Dials in White	\$700
342	Seat Heating	\$510
630	Light Design Package	\$700
P13	Automatically Dimming Mirrors with Integrated Rain Sensor	\$330
886	Steering Wheel with 12 O'Clock Marker in Red	\$510
CGJ	Sport Chrono Stopwatch Dial in White	\$0
581	Luggage Net in Passenger Footwell	\$1,500
749	Leather Interior Stitching in Red	\$590
XLU	Sun Visors in Alcantara®	\$760
X69	Door Sill Guards in Carbon Fiber	\$1,600
9VL	BOSE® Surround Sound System	
Total Retail Vehicle Price:		\$163,560
Delivery, Processing and Handling Fee:		\$1,050
Gas Guzzler Tax:		\$1,700
Total of Charges & Taxes:		\$2,750
Total Retail Price*:		\$166,310

*Total Retail Price is the Manufacturer's Suggested Retail Price (MSRP) plus options and manufacturer charges and taxes. It excludes tax, title, registration, and dealer charges. Dealer sets actual selling price.

PORSCHE
APPROVED
CERTIFIED PRE-OWNED

Vehicle Data

Dealer # : 4501148 Dealer Name : Isringhausen Imports
VIN : WPOAC2A9XJS175060 Model Year : 2018 Model Name : 911 GT3 In-Service Date : 03/03/18 Repair Order : 218424 Mileage : 5928
Engine # : 003701 Trans # : 5003047

Vehicle Source

☒ Trade ☐ Auction ☐ Lease Return ☐ Service Loaner ☐ Demo Unit ☐ CPD Inventory

Check of PDW/VAL in PGIS
☒ Yes ☐ No

Does this vehicle have any aftermarket accessories installed? ¹ ☐ Yes ☒ No

Has Autocheck VHR? ☒ Yes ☐ No Has Carfax VHR? ☐ Yes ☒ No

Vehicle Documentation

Check PPN Warranty History For:

☒ pass ☐ fail Mileage discrepancies ² ☒ pass ☐ fail
☒ pass ☐ fail Odometer: check for tampering ☒ pass ☐ fail

Open recall campaigns/service actions completed

Glove Box Portfolio, Include:

☒ pass ☐ fail Owner's Manual ☒ pass ☐ fail
☒ pass ☐ fail Maintenance Booklet ☒ pass ☐ fail

Warranty Booklet

All servicing documented by Porsche dealers

Maintenance:

☒ pass ☐ fail Perform Scheduled Maintenance ☒ pass ☐ fail
☒ pass ☐ fail All emission control systems must be functional. ☒ pass ☐ fail
☒ pass ☐ fail Retrieve and address any fault codes ☐ pass ☐ fail

Air Bag System Maintenance

Check CME control unit for signs of tampering

CD changer code (card) number (optional) : Navigation CD/DVD version (optional) : Number of keys : 2

☒ pass ☐ fail Vehicle tool kit, jack, compressor, emergency tire kit, first aid kit, wheel anti-theft protection, spare wheel, warning triangle.

Lights, Switches & Accessories

☒ pass ☐ fail Ignition/Starter switch ☒ pass ☐ fail
☒ pass ☐ fail Emergency flasher switch ☒ pass ☐ fail
☒ pass ☐ fail Stop lights ☒ pass ☐ fail
☒ pass ☐ fail All exterior lights checked for operation ☒ pass ☐ fail
☐ pass ☐ fail Cigarette lighter ☒ pass ☐ fail
☒ pass ☐ fail Windshield and rear window wipers ☒ pass ☐ fail
☒ pass ☐ fail Headlight washers ☒ pass ☐ fail
☒ pass ☐ fail Warning display lights and sounds ☒ pass ☐ fail
☒ pass ☐ fail Power window switches ☐ pass ☐ fail

Interior mirror adjustment

Windshield and rear window washer system

Horn(s)

Instrument panel dimming

Park Assistant

Exterior: Underbody, Body, Doors, Lids & Top

For the purpose of evaluating body and paint for eligibility in the Porsche Approved Certified Pre-Owned Program, vehicles will be ineligible if the body of the vehicle has sustained excessive collision damage where:

1. The body of the vehicle has structural damage and/or sub-par repair.
2. Panels are misaligned and have a wave like appearance.
3. Panels have been painted and there are signs of mismatched paint or inconsistencies in the finish of the paint.
4. Signs of structural damage, e.g. damaged flanges, loose or broken joining elements (spot welds, rivets, etc.) and/or deformities in the sheet metal.
5. Paint work is inconsistent in texture and color.

Is there visible evidence of existing body damage to the vehicle? ³ ☐ Yes ☒ No

Underbody Components:

☒ pass ☐ fail Axle joints ☒ pass ☐ fail
☒ pass ☐ fail Gas Cap ☒ pass ☐ fail
☒ pass ☐ fail Front/Rear lid release actuation ☒ pass ☐ fail
☒ pass ☐ fail Exhaust system ☒ pass ☐ fail
☒ pass ☐ fail Fuel lines/hoses ☒ pass ☐ fail

Leaks: engine, transmission, differential, transfer case

Wheel locks

Underbody inspection for damage/corrosion

Brake lines/hoses

Coolant hoses and connections

Door Inspection:

☒ pass ☐ fail Hinges ☒ pass ☐ fail
☒ pass ☐ fail Door locks ☒ pass ☐ fail
☒ pass ☐ fail Window lifter mechanisms ☒ pass ☐ fail

Door closing

Check straps

Other / Misc:

☒ pass	☐ fail	Seat adjusters	☒ pass	☐ fail	Sunroof/sliding roof mechanisms and locks
☐ pass	☐ fail	Cabriolet top operation	☒ pass	☐ fail	Targa top operation
☒ pass	☐ fail	Glass chips or cracks	☒ pass	☐ fail	Trailer hitch

Tires / Brakes

Tread Depth Measurements (minimum of 4mm or 50%)

Measuring points (mm)	Inside	Center	Outside
Front left	4.5	5.5	5.1
Rear left	5.3	5.7	5.5
Rear right	4.6	4.6	4.2
Front right	4.7	4.5	4.8

ALL four tires must be of the same brand, model, speed rating, and specification code. If the measurement on any OEM approved or N-Spec tire is less than 4/32 (4mm) or the tread depth measures less than 50% from tread depth when the tire was new, the tire must be replaced with the most recent N Spec tire available at the time of this inspection.

All tires six (6) years old must be replaced regardless of condition.

Aftermarket tires do not disqualify a unit from the CPD program but an addendum must be presented to the owner stating they are not covered under the respective Tire Manufacturers Warranty.

☒ pass	☐ fail	Tire size	☒ pass	☐ fail	Brake calipers/cylinders, air ducts, cover plates
☒ pass	☐ fail	Tire pressures			
☒ pass	☐ fail	Tire pressure monitor			

Brake Pad Wear (Approximate % of pad remaining)

If less than 50% of the brake pad remains the pads must be replaced.

Left Front	Right Front	Left Rear	Right Rear
100	100	100	100

Engine Compartment

☒ pass	☐ fail	Engine CO/HC	☒ pass	☐ fail	Alternator/fuse block
☒ pass	☐ fail	Alternator/on-board voltage	☒ pass	☐ fail	Ignition system
☒ pass	☐ fail	A/C compressor	☒ pass		
☒ pass	☐ fail	Engine	☒ pass		Belts and hoses

Battery type: ☐ OEM ☒ Aftermarket
Battery % State of Health : 90

Fluids

☒ pass	☐ fail	Engine oil	☒ pass	☐ fail	Front/rear axle differential oil
☒ pass	☐ fail	Transmission oil	☒ pass	☐ fail	Coolant
Antifreeze protection temp (°C) : <u>-38</u>					
☐ pass	☐ fail	Power steering hydraulic oil	☒ pass	☐ fail	Brake fluid
☒ pass	☐ fail	Clutch fluid	☒ pass	☐ fail	Windscreen/headlight washer fluid

Interior

☒ pass	☐ fail	Door locking system (child-proof locks)	☒ pass	☐ fail	Remote control
☒ pass	☐ fail	Alarm system and immobiliser	☒ pass	☐ fail	Ignition and ignition lock
☐ pass	☐ fail	Steering wheel lock	☒ pass	☐ fail	Horn
☒ pass	☐ fail	Airbag system (child seat detection)	☒ pass	☐ fail	Wipers front and rear
☒ pass	☐ fail	Steering column adjustment	☒ pass	☐ fail	Seat belts and seat belt height adjustment
☒ pass	☐ fail	Seat adjustment, position memory, heating and ventilation	☒ pass	☐ fail	Seat and head restraint upholstery
☒ pass	☐ fail	Sun visors	☒ pass	☐ fail	Roof lining
☒ pass	☐ fail	Floor mats and carpet	☒ pass	☐ fail	Interior trim and luggage compartment
☒ pass	☐ fail	Glove box	☒ pass	☐ fail	Cupholders
☐ pass	☐ fail	Ashtrays	☒ pass	☐ fail	Cigarette lighter/sockets (12v)
☒ pass	☐ fail	Instrument panel (check while stationary)	☒ pass	☐ fail	On-board clock
☒ pass	☐ fail	PCM (radio, telephone, CD, DVD, navigation system, Porsche Connect)	☒ pass	☐ fail	CD changer
☒ pass	☐ fail	Interior lighting	☒ pass	☐ fail	Heating/ventilation/air conditioning/climate control
☒ pass	☐ fail	Exterior mirror/rear-view mirror adjustment	☒ pass	☐ fail	Power windows (anti-pinch protection)
☒ pass	☐ fail	Bonnet/tailgate release	☒ pass	☐ fail	Roof (Cabriolet, Targa, sliding sunroof)

Equipment notes		Equipment/Exclusive equipment	
pass	fail	pass	fail
Cabricolet wind deflector			
Test Drive			
Does this vehicle have SiriusXM?		☐ Yes ☒ No	
☒ pass	☐ fail	☒ pass	☐ fail
(Cold start/idling characteristics)		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
ABS		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
PASM/air suspension		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Power steering/Servotronic		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Straight-ahead travel		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Vehicle performance		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Gear change		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
ParkAssist/reversing camera		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Cruise control (all functions)		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Instrument panel		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Lane Departure Warning (LDW)		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Distance Control System		☒ pass	☐ fail
☒ pass	☐ fail	☒ pass	☐ fail
Warm-start/idling characteristics		☒ pass	☐ fail
		☒ pass	☐ fail

Photos

* Photos are attached on a separate page.

The signatures of the mechanic, service manager and pre-owned manager are confirmation that this Porsche has been meticulously inspected and that detected defects have been rectified in accordance with the Porsche Approved Certified Pre-Owned Program. This inspection is invalid without all required signatures.

12/23/20

Date

Technician

01/07/21

Date

Luke Isringhausen

Pre-Owned Manager

01/07/21

Date

Anthony Hofgren

Service Manager

Date

Purchasing Customer


* Any errors that may arise at a later date that compromise the integrity of the vehicle may be covered by buy back protection offered by the vehicle history company. Consult Experian Autocheck or CARFAX for details.
This checklist was started on 12/23/20 and was completed on 01/07/21 by Isringhausen Imports (#4601148)

- For vehicle eligibility, aftermarket components are limited to: Exhausts, Exhaust Systems (excluding any emission components, e.g. O2 Sensor, Catalytic Converter), Tires, Wheels, Rims, Batteries and Trailer Hitches for Cayenne and Macan only. Aftermarket items must be represented by an addendum sticker. These components and any consequential damage caused by their installation are not covered under the Porsche Approved Pre-Owned Limited Warranty.
- Pass = Component or system meets Porsche guidelines and standards. Fail = Does not meet Porsche guidelines and standards. Repair or replacement of component or system is required.
- Any dings or scratches on the vehicle should be denoted in the technician(s) notes.


Vehicle Photos



Exterior LF Corner

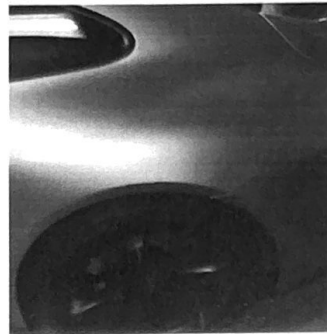


Exterior LR Corner

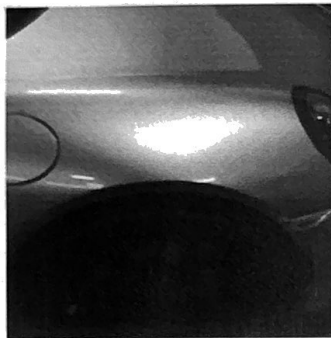


Exterior RF Corner



Exterior RR Corner

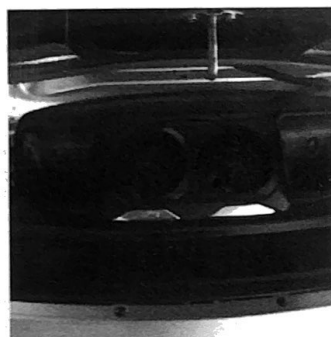


Exterior Engine

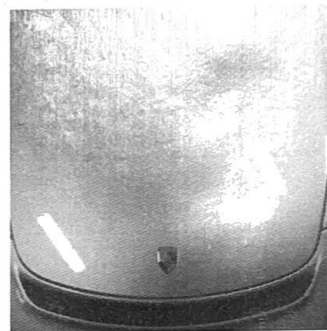

Exterior Hood



Exterior Deck Lid (or misc if not equipped)

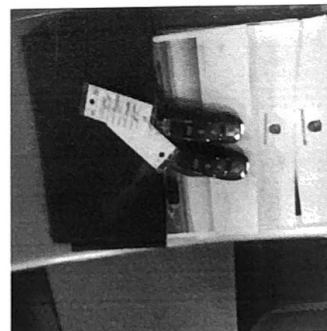

Miscellaneous (Keys/Manual, Tires, etc.)

Statement of Certification

We're proud of our technicians, and no one knows a Porsche better than them. Rigorous mechanical and cosmetic standards must be met by every Porsche Approved Certified Pre-Owned Vehicle. This is part of the meticulous preparation process undertaken prior to sale. You can be assured that your new Porsche Approved Certified Pre-Owned Vehicle has undergone service and preparation worthy of the Porsche name and meets the standards you would expect of us.



New Car In Service Date	03/03/18
Model Year	2018
Model Name	911 GT3
Vehicle Identification Number (VIN)	WP0AC2A9XJS175060

Quality

- Your Porsche Approved Certified Pre-Owned vehicle has a vehicle history report*
- Your Porsche Approved Certified Pre-Owned Vehicle has been inspected by factory trained technicians who conducted a 111+ point mechanical and cosmetic inspection
- Your Porsche Approved Certified Pre-Owned Vehicle has had all repairs and reconditioning carried out in line with the strict quality inspection standards

Satisfaction

- A clean car ready for delivery
- A full tank of gas
- Statement of Certification Sticker placed in driver side door jamb

Warranty

This warranty is given to the owner of any qualifying Porsche Approved Certified Pre-Owned vehicle (distributed by PCNA and sold by an authorized Porsche automobile dealer in the United States).

- 2 Years / Unlimited Mileage Warranty coverage from the expiration of the new vehicle limited warranty or from the date of sale if the new vehicle limited warranty has expired†
- 2 Years / Unlimited Mileage Porsche Roadside Assistance
- Factory trained technicians perform repairs
- No deductible, straightforward administration
- Redeemable at every Porsche Dealer
- Only Genuine Porsche parts are used

† This new warranty does not apply to vehicles sold as CPO prior to December 1, 2017 or vehicles with an existing 2 year/ 100K mileage warranty while still covered under new vehicle limited warranty. This warranty is not valid on sales by any non authorized commercial dealer or broker. If this vehicle is traded to a non-authorized Porsche dealer or broker for resale purposes, the Certified Pre-Owned Limited Warranty is void. For complete warranty coverage details, please refer to your Porsche Approved Certified Pre-Owned Limited Warranty Manual.

_____ Customer Signature	_____ Porsche Sales Professional Signature	_____ Date
-----------------------------	---	---------------

* Any errors that may arise at a later date that compromise the integrity of the vehicle may be covered by buy back protection offered by the vehicle history company. Consult Experian Autocheck or CARFAX for details.
This checklist was started on 12/23/20 and was completed on 01/07/21 by Isinghausen Imports (#4601148)

PORSCHE

**APPROVED
CERTIFIED PRE-OWNED**

Statement of Certification - Warranty Conditions

Warranty Coverage

Porsche Cars North America, Inc. will repair or replace with a new or remanufactured part distributed by PCNA, at its sole option, any factory-installed part that is faulty in material or workmanship under normal use. (Normal vehicle use is described in this Booklet.) Warranty repairs will be made free of charge for parts and labor at an authorized Porsche dealer. These express warranties are provided by PCNA, and are in lieu of all other express warranties of PCNA, the manufacturer, and selling dealer.

This Warranty covers all parts of the following components:

- Engine
- Fuel system/cooling system
- Drive/transmission
- Suspension/steering
- Brake system
- Heating/air conditioning
- Electrics
- Body

Warranty Exclusions

Specifically excluded from this coverage are:

- Vehicle abuse, vandalism, accidents, acts of God, competition racing or track use, or other events beyond control of PCNA
- Fines, taxes or impound fees caused by a violation of local or state law
- Expenses related to hazardous weather conditions (removal from snow, ice, etc.)
- If your Porsche has aftermarket tires and/or wheels installed or has had the suspension modified, PCNA will not cover the cost of transport of your vehicle, but this expense will not be covered under the Porsche Roadside Assistance program.
- Wear and tear items defined by PCNA
- Scheduled maintenance

Warranty outside the U.S.

If your car is taken to an authorized Porsche dealer outside the U.S. or Canada, the Porsche Approved Certified Pre-Owned Limited Warranty is redeemable at Porsche dealerships worldwide. This warranty coverage applies to vehicles sold on or after 12/01/2017, however excludes Roadside Assistance. A vehicle which is imported by an individual into Canada must comply with all Canadian governmental requirements.

Warranty Transfer

The balance of this Porsche Approved Certified Pre-Owned Limited Warranty may be transferred to another private owner through retail transaction. Porsche Cars North America, Inc. does not charge a fee for this transfer, but requires that a Change of Address Card found at the back of this book be mailed to PCNA to update our records.

* Any errors that may arise at a later date that compromise the integrity of the vehicle may be covered by buy back protection offered by the vehicle history company. Consult Experian Autocheck or CARFAX for details.
This checklist was started on 12/23/20 and was completed on 01/07/21 by Isringhausen Imports (#4501148)

18' BT SILVER

PORSCHE		FAP WIPAC		01127_142729_1606508861	
Calibration Verification Numbers		KDA ED ED 32			
A210_Kickdown detected = 1		0.0000 °Ck			
N500_Bank 1 exhaust camshaft deviation		0.0000 °Ck			
N500_Bank 2 exhaust camshaft deviation		0.0000 °Ck			
N050_Bank 2 intake camshaft deviation		122			
Z211_Overspeed range 1: Number of ignitions		10			
Z212_Overspeed range 2: Number of ignitions		0			
Z213_Overspeed range 3: Number of ignitions		0.0000 °			
S010_Secondary-air mass, bank 1		0.0000 °			
S020_Secondary-air mass, bank 2		0.0000 °			
K060_Catalytic converter temperature, bank 1		353.334 °C			
K070_Catalytic converter temperature, bank 2		353.053 °C			
Z201_Maximum engine speed reached		9152.50 rpm			
Z202_Total operating duration at engine overspeed		1.60 s			
K020_Catalytic converter store, bank 1		0.00000 °			
K030_Catalytic-converter state, bank 2		0.00000 °			
C070_Clutch pedal position		0.00000 °			
Z214_Overspeed range 4: operating time		10.7910 %			
Z215_Overspeed range 5: operating time		0.0 min			
Z216_Overspeed range 6: operating time		0.0 min			
Z214_Overspeed range 4: Number of ignitions		0			
Z215_Overspeed range 5: Number of ignitions		0			
Z216_Overspeed range 6: Number of ignitions		0			
B320_Fuel low pressure actual-value		633.600 kPa			
K100_Catalytic converter heating active		0			
O061_Oil pressure (relative) for instrument cluster		-31.900 MPa			
C042_Adaptation of upper shift gate (1,3,5,7,R), 1 = complete		1			
C062_Adaptation of lower shift gate (2,4,6), 1 = complete		1			
C022_Neutral position adaptation, 1 = complete		1			
C060_Adapted mean value of lower shift gate (2,4,6)		670.0 mV			
C040_Adapted mean value, upper shift gate (1,3,5,7,R)		4520.0 mV			
C044_Fuel/air ratio sensor (angle)		-0.050 °			
T030_Engine temperature (measured)		51.8 °C			
T040_Lambda-air temperature		38.3 °C			
L380_Bank 1 fuel trim adaptation active, close to idle (RKA1)		NO			
L390_Bank 2 fuel trim adaptation active, close to idle (RKA1)		NO			
L400_Bank 1 fuel trim adaptation active, load range (FRA)		NO			
L410_Bank 2 fuel trim adaptation active, load range (FRA)		NO			

Home

Diagnostics

Bluetooth

English



ALL SHINE NO GRIME
Mobile Detailing Service
14119 Whistling Duck Ct.
Charlotte, NC 28273
704-907-0623

Date:

2/16/21

N _____
A _____
C _____ State NC Zip 28226
P _____ Cell Phone () _____ - _____
Email _____

Year _____ Make _____ Model _____ Color of Vehicle _____

SERVICES RENDERED

Ceramic Pro Gold Package

\$1690.00

Method of Payment: ☐ **VISA** ☒ **MasterCard** ☐ **AMERICAN EXPRESS** ☐ **CASH**

Credit Card Authorization Code _____

Credit Card # _____ Exp. ____/____

☐ Check # _____ ☐ PO # _____

X _____

Authorized Signature

Subtotal	<u>1690.00</u>
Gratuity	<u>338.00</u>
Grand Total	<u>2,028.00</u>
Amount Paid	<u>—</u>
Balance Owed	<u>\$</u>

Special Instructions: _____

How did you hear about us?

- ☐ Past Customer ☐ Referred By Friend or Relative ☐ Drive By ☐ Saw Mobile Rig
☐ Yellow Pages ☐ Website ☐ Direct Mail ☐ TV ☐ Radio ☐ Received Business Card
☐ Other _____



ALL SHINE NO GRIME

Mobile Detailing Service

14119 Whistling Duck Ct.

Charlotte, NC 28273

704-907-0623

Date:

2/16/21

Name

Address

City

State NC

Zip

28226

Phone

Cell Phone ()

Email

Year

Make

Model

Color of Vehicle

SERVICES RENDERED

Ceramic Pro Gold Package

1690.00



Method of Payment:

Credit Card
Authorization Code

Credit Card #

Exp. /

☐ Check #

☐ PO #

X

Authorized Signature

Subtotal

1690.00

Gratuity

338.00

Grand Total

2,028.00

Amount Paid

—

Balance Owed

8

Special Instructions:

How did you hear about us?

- ☐ Past Customer ☐ Referred By Friend or Relative ☐ Drive By ☐ Saw Mobile Rig
☐ Yellow Pages ☐ Website ☐ Direct Mail ☐ TV ☐ Radio ☐ Received Business Card
☐ Other



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



CUSTOMER NO 32915		ADVISOR RUPEN PATEL	TAG NO 1058	INVOICE DATE 09/08/21	INVOICE NO POCS87682	
		LABOR RATE	LICENSE NO	COLOR	STOCK NO	
		MILEAGE 7,398 /				
		YEAR / MAKE / MODEL 18/PORSCHE/911/2DR CPE GT3				
		VEHICLE I.D. NO W P O A C 2 A 9 X J S 1 7 5 0 6 0				
RESIDENCE PHONE		BUSINESS PHONE		DELIVERY DATE	DELIVERY MILES	
				SELLING DEALER NO	PRODUCTION DATE	
				R.O. DATE 08/30/21		
		COMMENTS				MO: 7403

LABOR & PARTS
JOB # 1 11POZCKENG CK ENG LIGHT TECH(S):130258
CUSTOMER STATES CK ENG LIGHT IS ON
customers concern of check engine light on verified, ran VAL
at 13.8 volts and found code P2096 for bank 1 O2 sensor.
followed GFF and check fuel trim for both banks, checked
vacuum tightness of system. checked for exhaust leaks,
checked voltage power supply of O2 sensors. Found no exhaust
leaks, trim is correct on both banks and power supply 12V is
correct. O2 sensors electrically faulty.
Followed workshop manual and removed lock support again, due
to parts on order. disconnected and replaced O2 sensor.
cleared fault and test drove.

WARRANTY

Shop fees and/or other discretionary fees relating to environmental or regulatory compliance, record retention, or other costs incurred by the dealer that are regulated by N.C. Gen. Stat. §20-101.3 may or will be charged by the dealer. Some or all of these fees may be attributable to or cover the dealer's internal overhead.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1	1	9A1-606-191-81	LAMBDA PROBE	

J# 2 02POZMPI PERFORM MPI TECH(S):
PERFORM MPI
PERFORMANCE AND SAFETY INSPECTION
MPI completed. Topped off oil

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 2 TOTAL LABOR & PARTS				0.00

G.O.G. & SUPPLIES	WARRANTY
JOB # 1 FREIGHT (PARTS)	0.00
TOTAL - GOG	0.00

ESTIMATE
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
ORIGINAL ESTIMATE OF \$0.00 (+TAX)

THANK YOU FOR YOUR BUSINESS!!!!!!

VISIT OUR WEBSITE AT WWW.HENDRICKPORSCHE.COM

TOTAL LABOR....	0.00
TOTAL PARTS....	0.00
TOTAL SUBLET....	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	0.00
TOTAL MISC DISC	0.00
TOTAL TAX.....	0.00
TOTAL INVOICE \$	0.00

CUSTOMER SIGNATURE

Customers should inquire of dealer personnel if they would like to know the type and amount or details of the fees charged by the dealer.

I hereby acknowledge that a copy of your Privacy Policy has been made available to me and that I may access your Privacy Policy at www.hendrickprivacy.com/privacy_policy.

Customer agrees that this Agreement includes all of the terms and conditions on the front and back side hereof, that this Agreement cancels and supersedes any prior agreement including oral agreements, and as of the date below comprises the entire agreement between Customer and Dealer relating to these repairs or other matters referred to on the front or back side of this document.

Customer Signature



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



CUSTOMER NO 32915	ADVISOR SHANE CARELOCK	TAG NO 896	INVOICE DATE 09/22/23	INVOICE NO POCS103633
RANDY OLSON	LABOR RATE	LICENSE NO	9,653	COLOR GT SILVER/
	YEAR / MAKE / MODEL 18/PORSCHE/911/2DR CPE GT3			DELIVERY DATE
	VEHICLE ID NO W P O A C 2 A 9 X J S 1 7 5 0 6 0			DELIVERY MILES
	FTE NO			SELLING DEALER NO
COMMENTS			R.O. DATE 09/22/23	PRODUCTION DATE
MO: 9653				

LABOR & PARTS-----
J# 1 02POZ12 YEARLY SERVICE TECH(S):122581 416.10
CUSTOMER STATES PERFORM YEARLY SERVICE.
reset main light for client
READ FAULT MEMORY ON PCM DIAGNOSIS SYSTEM,VISUAL INSPECTION
OF WIRING, HOSES,UNDERSIDE PANELS,REPLACED ENGINE OIL WITH
MOBIL1 SYNTHETIC OIL,REPLACED OIL FILTER WITH GENUINE
PORSCHE FILTER,CHECKED AIR INTAKE AIR DUCTS FOR BLOCKAGES,
CHECKED ALL FLUID LEVELS,CHECKED BRAKE PADS AND ROTORS FOR
WEAR,CHECKED SUSPENSION FOR EXCESSIVE WEAR,CHECKED TIRE

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1	1	PK0120	991.2 GT3/RS 10K	101.78
JOB # 1	1	OPB-115-351	OIL FILTER	21.44
JOB # 1	2	900-123-159-20	SEALING RING	13.85
JOB # 1	1	N-013-832-6	SEALING RING	13.34
JOB # 1	9	110539	MOBIL OW-40	14.30
JOB # 1	1	SSZERO	WASHER SOLVENT	

JOB # 1 TOTAL PARTS 248.90

The Service Charge covers or defrays some of Dealer's service department overhead costs, including, but not limited to, shop supplies, employee safety measures and training, and waste disposal and handling, many of which do not lend themselves to precise itemization. Not all repair actions will cause all of the costs defrayed by the Service Charge. Service Charge may include profit. The Service Charge is not a required fee.

J# 2 02POZMPI PERFORM MPI TECH(S):122581
PERFORM MPI
PERFORMANCE AND SAFETY INSPECTION

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 2 TOTAL LABOR & PARTS				0.00

J# 3+61POZ GENERAL ELECT. SYS. TECH(S):122581
ACTIVE FAULTS FOR PARKING BRAKE ACTUATOR ABOVE LIMIT VALUE.
RECOMMEND ADJUST AND RE CALIBRATE PARKING BRAKE SHOES.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 3 TOTAL LABOR & PARTS				0.00

MISC	CODE	DESCRIPTION	CONTROL NO
JOB # A	SS	SERVICE CHARGE	36.00
JOB # 1	PL10	Customer Appreciation Award Labor	-269.02
JOB # 1	PP10	Customer Appreciation Award Parts	-90.00
TOTAL - MISC			-323.02

ESTIMATE
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
ORIGINAL ESTIMATE OF \$413.99 (+TAX)
APPROVED ADDITIONAL COST OF \$470.00 FOR TOTAL ESTIMATE OF \$883.99 (+TAX) ON 09/22/23 AT 09:51am
BY RANDY OLSON COMMENTS

++WAITER++

I have read and understand a copy of the Privacy Policy and I agree to the terms of our Privacy Policy at www.hendrickporsche.com/privacy-policy.

By the privacy of our staff and other customers, you hereby consent to deactivation of any audio or video recording devices in or on your vehicle.

Customer agrees that this Agreement includes all of the terms and conditions on the front and back side hereof, that this Agreement cancels and supersedes any prior agreement including oral agreements, and as of the date below comprises the entire agreement between Customer and Dealer relating to these repairs or other matters referred to on the front or back side of this document.

Customer Signature

(CONTINUED ON NEXT PAGE) 10:19am



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



CELL: 704-317-9217

CUSTOMER NO 32915	ADVISOR SHANE CARELOCK	TAG NO 217	INVOICE DATE 06/29/22	INVOICE NO POCS93921
	LABOR RATE	LICENSE NO	MILEAGE 8,143	COLOR
	YEAR / MAKE / MODEL 18/PORSCHE/911/2DR CPE GT3			
	VEHICLE ID NO WP0AC2A9XJS175060			
	FTE NO			
	P.O. NO			
	R.O. DATE 06/28/22			
RESIDENCE PHONE	BUSINESS PHONE		COMMENTS	
MO: 8147				

LABOR & PARTS
JOB # 1 02POZ12 YEARLY SERVICE TECH(S):916 370.50

CUSTOMER STATES PERFORM YEARLY SERVICE. customer states
reset main light to the 4 year service for next visit
READ FAULT MEMORY ON PCM DIAGNOSIS SYSTEM,VISUAL INSPECTION
OF WIRING, HOSES,UNDERSIDE PANELS,REPLACED ENGINE OIL WITH
MOBIL1 SYNTHETIC OIL,REPLACED OIL FILTER WITH GENUINE
PORSCHE FILTER,CHECKED AIR INTAKE AIR DUCTS FOR BLOCKAGES,
CHECKED ALL FLUID LEVELS,CHECKED BRAKE PADS AND ROTORS FOR
WEAR,CHECKED SUSPENSION FOR EXCESSIVE WEAR,CHECKED TIRE

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 1	1	PK0120	991.2 GT3/RS 10K	****	****
JOB # 1	1	OPB-115-351	OIL FILTER	84.61	84.61
JOB # 1	2	900-123-159-20	SEALING RING	17.06	34.12
JOB # 1	1	N-013-832-6	SEALING RING	10.90	10.90
JOB # 1	9	110539	MOBIL OW-40	11.99	107.91
JOB # 1	1	55ZERO	WASHER SOLVENT	13.80	13.80
JOB # 1 TOTAL PARTS				251.34	

JOB # 1 TOTAL LABOR & PARTS 621.84

JOB # 2 02POZMPI PERFORM MPI TECH(S):916 0.00
PERFORM MPI
PERFORMANCE AND SAFETY INSPECTION
ok

PARTS-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 2 TOTAL PARTS 00
JOB # 2 TOTAL LABOR & PARTS

JOB # 3+11POZZENGINES ENGINE LEAK CONCERN TECH(S):916 WAF
Center feed oil tube is leaking oil.
On inspection, Found that the center feed oil tube was
leaking oil. Cleaned off oil and applied leak trace powder.
Test drove and confirmed location of the oil leak. Failure
is mechanical. No documents pertaining to this issue.
Removed RR wheel. Removed rear bumper. Removed Right side
front muffler. Removed rear muffler. Removed the AC
compressor and moved it aside with lines connected. Removed
center feed oil tube with cartridge and replaced then.
Reinstalled all previously removed parts and set oil level
through tester. Performed test drive after repair to verify.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 3	1	PKGT3-OIL-LEAK	OIL LEAK		WARRANTY
JOB # 3	1	9A1-107-167-93	OIL PIPE		WARRANTY
JOB # 3	1	OPB-129-763	RUBBER ELEMENT		WARRANTY
JOB # 3	1	OPB-129-219	GASKET		WARRANTY
JOB # 3	6	900-385-127-02	OUTER HEXAGON RO		WARRANTY
JOB # 3	2	999-707-155-42	O-RING		WARRANTY
JOB # 3	2	999-707-699-40	O-RING 16,00X2,0		WARRANTY
JOB # 3	1	9A7-573-749-03	O-RING		WARRANTY
JOB # 3	2	997-111-336-90	SPHERICAL CLAMP		WARRANTY

Shop fees and/or other discretionary fees relating to environmental or regulatory compliance, record retention, or other costs incurred by the dealer that are regulated by N.C. Gen. Stat. §20-101.3 may or will be charged by the dealer. Some or all of these fees may be attributable to or include the dealer's internal overhead or profit.

Customers should inquire of Customer Relationship Personnel if they would like to know the type and amount of fees on the basis of the dealer.

I hereby acknowledge a copy of your Privacy Policy is located in the back of the vehicle. I may access your Privacy Policy at www.hendrickporsche.com/privacy_policy

For the privacy of our staff and other customers, you hereby consent to deactivation of any audio or video recording devices in or on your vehicle.

Customer agrees that this Agreement includes all of the terms and conditions on the front and back side hereof, that this Agreement cancels and supersedes any prior agreement including oral agreements, and as of the date below comprises the entire agreement between Customer and Dealer relating to these repairs or other matters referred to on the front or back side of this document.

Customer Signature



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



32915		ALVISON		TAG NO.		INVOICE DATE		INVOICE NO	
SHANE CARELOCK		896		655		09/22/23		POCS103633	
LABOR RATE		LICENSE NO		MILEAGE		COLOR		STOCK NO	
				9,653		GT SILVER/			
YEAR MAKE MODEL		18/PORSCHE/911/2DR CPE GT3		DELIVERY DATE		DELIVERY MILES			
VEHICLE NO		W P O A C 2 A 9 X J S 1 7 5 0 6 0		SELLING DEALER NO		PREPARE TIME DATE			
FTE NO		P.C. NO		H.O. DATE					
				09/22/23					
COMMENTS									
TOTALS								MO: 9653	

THANK YOU FOR YOUR BUSINESS!!!!!!
VISIT OUR WEBSITE AT WWW.HENDRICKPORSCHE.COM

TOTAL LABOR	854.10
TOTAL PARTS	292.87
TOTAL SUBLET	0.00
TOTAL G.O.G.	0.00
TOTAL MISC CHG.	36.00
TOTAL MISC DISC	-359.02
TOTAL TAX	59.74
TOTAL INVOICE \$	883.69

The Service Charge covers or defrays some of Dealer's service department overhead costs, including, but not limited to, shop supplies, employee safety measures and training, and waste disposal and handling, many of which do not lend themselves to precise itemization or allocation. Not all repair or service transactions will cause Dealer to incur all of the costs defrayed by the Service Charge. The Service Charge may include Dealer profit. The Service Charge is not a government required fee.

I hereby acknowledge that a copy of your Privacy Policy has been made available to me and that I may access your Privacy Policy at www.hendrickprivacy.com/privacy_policy.

For the privacy of our staff and other customers, you hereby consent to deactivation of any audio or video recording devices in or on your vehicle.

Customer agrees that this Agreement includes all of the terms and conditions on the **front and back side hereof**, that this Agreement cancels and supersedes any prior agreement including oral agreements, and as of the date below comprises the entire agreement between Customer and Dealer relating to these repairs or other matters referred to on the front or back side of this document.

Customer Signature



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



CELL: 704-317-9217

CUSTOMER NO 32915	ADVISOR SHANE CARELOCK	TAG NO 896 217	INVOICE DATE 06/29/22	INVOICE NO POCS93921
	LABOR RATE	LICENSE NO	MILEAGE 8,143	COLOR
	YEAR MAKE / MODEL 18/PORSCHE/911/2DR CPE GT3			DELIVERY DATE
	VEHICLE ID NO W P O A C 2 A 9 X J S 1 7 5 0 6 0			DELIVERY MILES
	FTE NO			SELLING DEALER NO
	P.O. NO			PRODUCTION DATE
RESIDENCE PHONE	BUSINESS PHONE			R.O. DATE 06/28/22
COMMENTS				

MO: 8147

LABOR & PARTS
J# 1 02POZ12 YEARLY SERVICE TECH(S):916 370.50

CUSTOMER STATES PERFORM YEARLY SERVICE. customer states
reset main light to the 4 year service for next visit
READ FAULT MEMORY ON PCM DIAGNOSIS SYSTEM,VISUAL INSPECTION
OF WIRING, HOSES,UNDERSIDE PANELS,REPLACED ENGINE OIL WITH
MOBIL1 SYNTHETIC OIL,REPLACED OIL FILTER WITH GENUINE
PORSCHE FILTER,CHECKED AIR INTAKE AIR DUCTS FOR BLOCKAGES,
CHECKED ALL FLUID LEVELS,CHECKED BRAKE PADS AND ROTORS FOR
WEAR,CHECKED SUSPENSION FOR EXCESSIVE WEAR,CHECKED TIRE

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 1	1	PK0120	991.2 GT3/RS 10K	****	****
JOB # 1	1	OPB-115-351	OIL FILTER	84.61	84.61
JOB # 1	2	900-123-159-20	SEALING RING	17.06	34.12
JOB # 1	1	N-013-832-6	SEALING RING	10.90	10.90
JOB # 1	9	110539	MOBIL OW-40	11.99	107.91
JOB # 1	1	55ZERO	WASHER SOLVENT	13.80	13.80
JOB # 1 TOTAL PARTS				251.34	
JOB # 1 TOTAL LABOR & PARTS				621.84	

J# 2 02POZMPI PERFORM MPI TECH(S):916 0.00

PERFORM MPI
PERFORMANCE AND SAFETY INSPECTION
ok

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 2 TOTAL PARTS				0.00	
JOB # 2 TOTAL LABOR & PARTS				0.00	

J# 3+11POZZENGINES ENGINE LEAK CONCERN TECH(S):916 WARRANTY

Center feed oil tube is leaking oil.
On inspection, Found that the center feed oil tube was
leaking oil. Cleaned off oil and applied leak trace powder.
Test drove and confirmed location of the oil leak. Failure
is mechanical. No documents pertaining to this issue.
Removed RR wheel. Removed rear bumper. Removed Right side
front muffler. Removed rear muffler. Removed the AC
compressor and moved it aside with lines connected. Removed
center feed oil tube with cartridge and replaced them.
Reinstalled all previously removed parts and set oil level
through tester. Performed test drive after repair to verify.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 3	1	PKGT3-OIL-LEAK	OIL LEAK		WARRANTY
JOB # 3	1	9A1-107-167-93	OIL PIPE		WARRANTY
JOB # 3	1	OPB-129-763	RUBBER ELEMENT		WARRANTY
JOB # 3	1	OPB-129-219	GASKET		WARRANTY
JOB # 3	6	900-385-127-02	OUTER HEXAGON RO		WARRANTY
JOB # 3	2	999-707-155-42	O-RING		WARRANTY
JOB # 3	2	999-707-699-40	O-RING 16,00X2,0		WARRANTY
JOB # 3	1	9A7-573-749-03	O-RING		WARRANTY
JOB # 3	2	997-111-336-90	SPHERICAL CLAMP		WARRANTY

Shop fees and/or other discretionary
fees relating to environmental or
regulatory compliance, record re-
tention, or other costs incurred by
the dealer that are regulated by N.C.
Gen. Stat. §20-101.3 may or will be
charged by the dealer. Some or all of
these fees may be attributable to or
include the dealer's internal overhead
or profit.

Customers should inquire of dealer-
ship Personnel if they would like to
know the type and amount or
basis of the fees charged by the
dealer.

I hereby acknowledge that a copy
of your Privacy Policy has been
made available to me and that I
may access your Privacy Policy at
www.hendrickprivacy.com/privacy_policy.

For the privacy of our staff and
other customers, you hereby con-
sent to deactivation of any audio
or video recording devices in or on
your vehicle.

Customer agrees that this Agree-
ment includes all of the terms and
conditions on the **front and back
side hereof**, that this Agreement
cancels and supersedes any prior
agreement including oral agree-
ments, and as of the date below
comprises the entire agreement
between Customer and Dealer
relating to these repairs or other
matters referred to on the front or
back side of this document.

Customer Signature

diagnostic and repair work
a payment for
attorney's fees which
may be recovered
in a lawsuit
against the
Hendrick Porsche
Charlotte



6800 East Independence Blvd.
CHARLOTTE, NORTH CAROLINA 28227
(704) 531-3344
www.hendrickporsche.com



CUSTOMER NO 32915		ADVISOR SHANE CARELOCK		TAG NO 896	INVOICE DATE 06/29/22	INVOICE NO POCS93921
		LABOR RATE		LICENSE NO	MILEAGE 8,143	COLOR
		YEAR / MAKE - MODEL 18/PORSCHE/911/2DR CPE GT3		DELIVERY DATE		DELIVERY MILES
		VEHICLE NO W P O A C 2 A 9 X J S 1 7 5 0 6 0		SELLING DEALER NO		PRODUCTION DATE
		FTE NO		P.O. NO	R.O. DATE 06/28/22	
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS				

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 3	2	997-111-561-90	SEALING RING	
JOB # 3	2	997-111-563-90	SEALING RING	
JOB # 3	1	999-707-439-41	O-RING	
JOB # 3	1	999-707-472-40	O-RING	
JOB # 3	2	999-707-557-41	O-RING	
JOB # 3	1	N-900-377-01	GROMMET	
JOB # 3	1	9A1-102-041-83	OIL PIPE	
JOB # 3	2	980-111-561-00	EXHAUST SEALING	
JOB # 3 TOTAL PARTS				0.00
JOB # 3 TOTAL LABOR & PARTS				0.00

J# 4+70POZSHUTTLE SHUTTLE TO AND FROM
PROVIDED SHUTTLE TO AND FROM
5403 COLONY RD
CHARLOTTE, NC 28226
TECH(S):916

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 4 TOTAL PARTS				0.00
JOB # 4 TOTAL LABOR & PARTS				0.00

MISC	CODE	DESCRIPTION	CONTROL NO
JOB # A	SS	SERVICE CHARGE	
JOB # 1	PL10	Customer Appreciation Award Labor	33.35
JOB # 1	PP10	Customer Appreciation Award Parts	-37.50
JOB # 4	PUDE	PICKUP/DELIVERY	-25.13
TOTAL - MISC			WARRANTY -29.28

ESTIMATE
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
ORIGINAL ESTIMATE OF \$357.99 (+TAX)
APPROVED ADDITIONAL COST OF \$3109.24 FOR TOTAL ESTIMATE OF \$3467.23 (+TAX) ON 06/28/22 AT 08:06a
BY RANDY OLSON COMMENTS

THANK YOU FOR YOUR BUSINESS!!!!!!
VISIT OUR WEBSITE AT WWW.HENDRICKPORSCHE.COM

TOTAL LABOR....	370.50
TOTAL PARTS....	251.34
TOTAL SUBLET....	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	33.35
TOTAL MISC DISC	-62.63
TOTAL TAX.....	42.96
TOTAL INVOICE \$	635.52

CUSTOMER SIGNATURE

Shop fees and/or other discretionary fees relating to environmental or regulatory compliance, record retention, or other costs incurred by the dealer that are regulated by N.C. Gen. Stat. §20-101.3 may or will be charged by the dealer. Some or all of these fees may be attributable to or include the dealer's internal overhead or profit.

Customers should inquire of dealership Personnel if they would like to know the type and amount or basis of the fees charged by the dealer.

I hereby acknowledge that a copy of your Privacy Policy has been made available to me and that I may access your Privacy Policy at www.hendrickprivacy.com/privacy_policy.

For the privacy of our staff and other customers, you hereby consent to deactivation of any audio or video recording devices in or on your vehicle.

Customer agrees that this Agreement includes all of the terms and conditions on the **front and back side hereof**, that this Agreement cancels and supersedes any prior agreement including oral agreements, and as of the date below comprises the entire agreement between Customer and Dealer relating to these repairs or other matters referred to on the front or back side of this document.

Customer Signature

MP MOTORWERKS

4044 South Blvd
Charlotte, NC 28209-2746
Tel. 980-939-1563
mpmotorwerks@gmail.com

MP Motorwerks

4044 SOUTH BLVD STE A
CHARLOTTE, NC
28209-2747

Sep 16, 2024
7:59 AM

2018 Porsche 911 GT3

License Plate: X136

4.0 GAS

WP0AC2A9XJS175060

N/A

Custom Amount x 1 \$2,526.65

Total \$2,526.65
AmEx 1012 (Contactless) \$2,526.65
Valued Customer

WORK PERFORMED**Parts**

Parts	Part No	Qty	Price	Total
245/35/20 Michelin Pilot Sport Cup 2 N1	AAA060002409	2.00	430.99	861.98
305/30/20 Michelin Pilot Sport Cup 2 N1	AAA060002414	2.00	577.99	1,155.98

SubTotal: Parts \$2,017.96

Mount & Balance

Labor	Tech	Hrs	Price	Total
Mount & Balance		4.00	35.00	140.00

SubTotal: Mount & Balance \$140.00

Alignment

Labor	Tech	Hrs	Price	Total
Alignment		1.00	179.99	179.99

SubTotal: Alignment \$179.99

Labor 319.99
Parts 2,017.96
Hazmat* 0.00
Supplies* 19.20
Taxes 169.50

Invoice Total \$2,526.65

* Shop Supply & Hazmat Fees. This charge represents costs and profits (where applicable) to this repair facility for miscellaneous shop supplies, and/or waste removal.

PAYMENTS

Date	Method	Reference	Amount
09-16-2024	AMEX	Paid 9 16 2024	2,526.65

Payment Total: 2,526.65

Balance Due 0.00

4044 South Blvd
Charlotte, NC 28209-2746
Tel: 980-939-1563
mpmotorwerks@gmail.com

4044 South Blvd
Charlotte, NC 28209-2746
Tel: 980-939-1563
mpmotorwerks@gmail.com

mppmotorwerks@gmail.com

Technician J
Date 3 31 2025
Estimate Q006080

Technician J
Date 3 31 2025
Estimate Q006080

License Plate: X [REDACTED]

Miles In:	11.479
Miles Out:	11.479

2018 Porsche 911 GT3
4.0 GAS
WP0AC2A9XJS175060
N/A

WORK PERFORMED

Oil Change Full Synthetic

	Tech	Hrs	Price	Total
Labor				
Shop Labor		0.50	0.00	0.00
Oil Change Full Synthetic		1.00	280.00	280.00

SubTotal: Oil Change Full Synthetic	\$280.00
-------------------------------------	----------

Labor	280 00
Parts	0 00
Hazmat*	0 00
Supplies*	16 80
Taxes	20 30

Invoice Total	\$317.10
---------------	----------

⁴ Shop Supply & Hazmat Fees. This charge represents costs and profits (where applicable) to this repair facility for miscellaneous shop supplies, and/or waste removal.

PAYMENTS

Date	Method	Reference	Amount
03-31-2025	AMEX	Paid 3 31 2025	317.10
Payment Total:			317.10

Balance Due 0.00

AUTHORIZATION

Date/Time:	Authorizer	Method	Contact Details	Original Estimate Total
				0.00
X _____ Customer Signature				